

Site HOTO Report — DHK_X5584

Project Tiger · Dhaly Infratech → Alliance Computers Limited · Generated 09-Sep-2026 04:45 BD time

91%

FORM COMPLETION

30/31

CHECKLIST OK

1

OPEN SNAGS

1

TOTAL SNAGS

15

PHOTOS ATTACHED

Incomplete: the following expected fields were left blank in this submission — Site Sharing.

SITE & HANDOVER DETAILS

SITE CODE	DHK_X5584	ZONE	Sylhet
HOTO DATE	2026-09-03	DISTRICT	Narsingdi
HANDOVER ORG	Dhaly Infratech	TAKEOVER ORG	Alliance Computers Limited
HANDOVER PERSON	Md Mahabub	TAKEOVER PERSON	Mir Hossain
HANDOVER PHONE	01615220637	TAKEOVER PHONE	01715163312
INSPECTED BY	Sojib Hossan	SECURITY GUARD	No
ACCESS KEY HANDED OVER	—	SITE TYPE	GF-RT
BTS TYPE	Outdoor		
SHARED WITH OPERATOR	Not Filled	SHARED OPERATOR NAME	—

GENERATOR INFORMATION

DG BRAND	Mets	GENSET ASSET NO.	—
CAPACITY (KVA)	13	TYPE	—
FUEL TANK CAPACITY	1000	PRESENT RH	4160.4
FUEL (NO WATER)	107.6 L	FUEL (TOTAL)	107.6 L
WATER AMOUNT	— L	FUEL AMOUNT (WORD)	One Hundred Seven Liters and Six Hundred Milliliters
DG SITE TYPE	—	DG LOCKED AFTER FUELING	Yes
DG PRESENT STATUS	OK	GENSET ON ALARM	OK
BATTERY BRAND	Hamko	BATTERY SERIAL	P033XGDJ0848
BATTERY AH	100	ENGINE SERIAL	LD6282393
ATS BRAND	—	ATS MODE	Auto
RH METER TYPE	—	LAST SERVICE DATE	—
KEY TYPE	Local Key	KEY STATUS — BTS	—
KEY STATUS — DG ROOM	—		

ACTIVE DG	1	CONNECTED FUEL TANKS	1
FAULTY/DISCONNECTED DG	—	FAULTY/DISCONNECTED TANKS	—

CONNECTED GENERATOR CHECKLIST & READINGS

ITEM	VALUE	ITEM	VALUE
Earth Connection OK	Yes	Load Current (A)	38
Phase	1 Phase	Voltage L1-N	226
Engine Brand	Perking	Controller Status	OK
Black Smoke Status	OK	DG Battery Charger	OK
ATS Physical & Functional Status	OK	DG Automation (VDTC/RVDTC/Rectifier) per BL Standard	OK
Fuel Preserved at Safe & Appropriate Location	OK	Exhaust Fan / Ventilation Sufficient When Running	OK
Sufficient Water in Radiator & Battery	OK	DG Radiator Condition	OK
DG Battery Condition	OK	DG Runs in Both Auto & Manual Mode	OK
GENSET ON Alarm Functioning Properly	OK	Lub Oil Status (Level & Colour)	OK
DG RH Meter Working Properly	OK	No Parts Missing (if missing, note in snags below)	OK
Mains Fail Alarm	OK	DC Low Alarm	OK
Rectifier Fault Alarm	OK	High Temperature Alarm	OK
Door Open Alarm	OK	DG Run Alarm	OK
DG Failure Alarm	OK	DG Low Fuel Alarm	OK
Tower / Pole Condition	OK	BTS Room Condition	OK
BTS Floor / Roof Condition	OK	Door Condition	OK
Locking Status	OK	Security Gate Condition	OK
Wall Condition	OK	Fire Extinguisher Status	NA
Site Cleaning Status	NOK		




SNAGS FOUND (1)

SNAG #	SYSTEM	CATEGORY	COMPONENT	STATUS	OBSERVATIONS	ACTION	PHOTO
S-052	General	Site Cleanliness/Bush	Site Cleaning Status	Faulty	Need Bush Clean	Open	

DEFICIENCIES & SAFETY REMARKS

DG MAJOR DEFICIENCIES	1,DG Controller Faulty 2,DG Front Site Canopy Missing 3, DG Auto Not Run 4, Need to Bush Clean
SAFETY REMARKS	—
GENERAL REMARKS	—

SITE PHOTOS

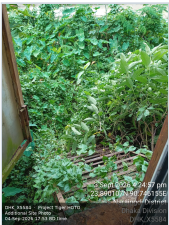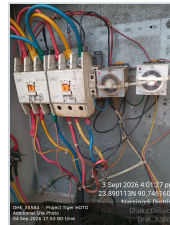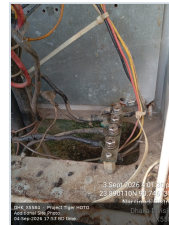 Site / Nameplate	 DG RH / Meter	 Fuel Gauge							
 Additional	 Additional	 Additional	 Additional	 Additional	 Additional	 Additional	 Additi		

Md Mahabub

Handed Over By · Dhaly Infratech
01615220637

Date: _____

Mir Hossain

Taken Over By · Alliance Computers
Limited
01715163312

Date: _____

BL Concern · Name / Signature

Date: _____

APPENDIX — PHOTO EVIDENCE (15)

Full-size reference photos for DHK_X5584, grouped by type and numbered for cross-reference against the tables above.

REQUIRED SITE PHOTOS (3)



Photo 1 — Site / Nameplate



Photo 2 — DG RH / Meter



Photo 3 — Fuel Gauge

SNAG EVIDENCE PHOTOS (1)



Photo 4 — S-052 — Site Cleaning Status

ADDITIONAL PHOTOS (11)



Photo 5 — Site Context 1

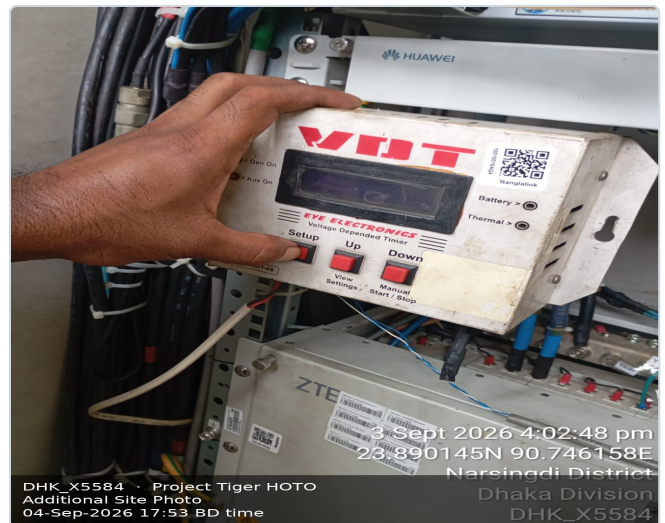


Photo 6 — Site Context 2

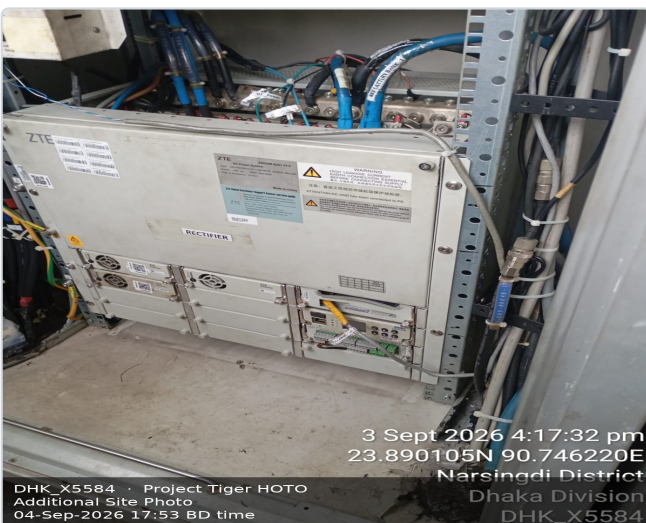


Photo 7 — Site Context 3



Photo 8 — Site Context 4

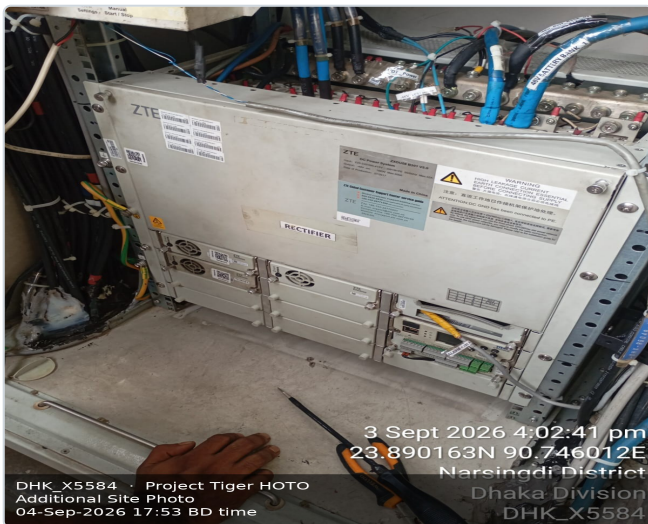


Photo 9 — Site Context 5

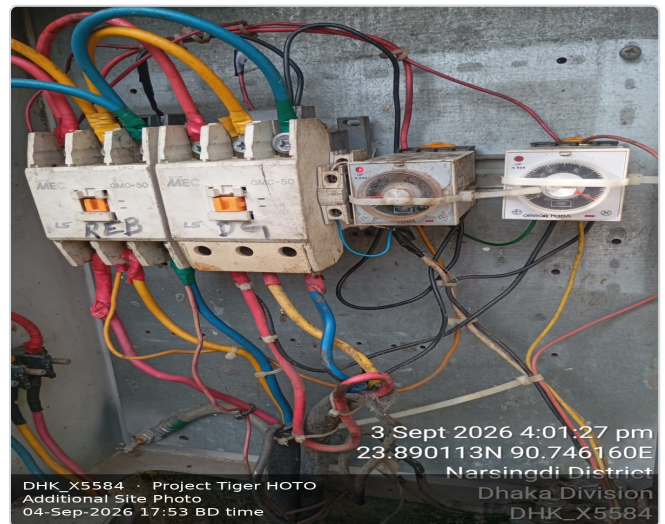


Photo 10 — Site Context 6



Photo 11 — Site Context 7

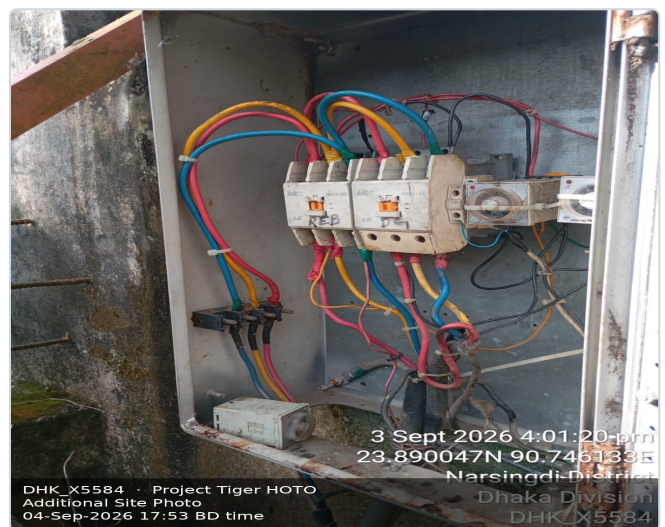


Photo 12 — Site Context 8

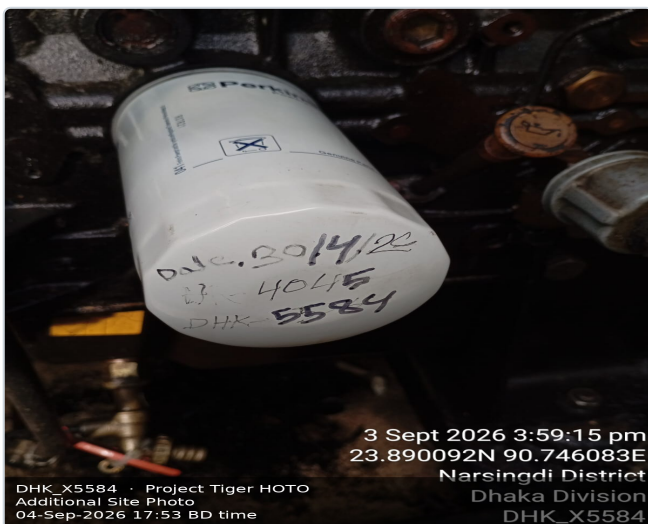


Photo 13 — Site Context 9

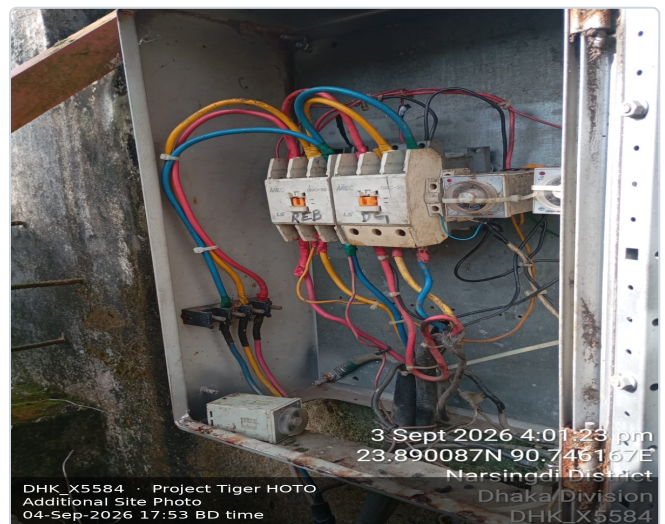


Photo 14 — Site Context 10



Photo 15 — Site Context 11