

Site HOTO Report — SYL_X0069

Project Tiger · Dhaly Infratech → Alliance Computers Limited · Generated 27-Oct-2026 12:13 BD time

91%

FORM COMPLETION

8/15

CHECKLIST OK

6

OPEN SNAGS

6

TOTAL SNAGS

35

PHOTOS ATTACHED

Incomplete: the following expected fields were left blank in this submission — Site Type.

SITE & HANDOVER DETAILS

SITE CODE	SYL_X0069	ZONE	Sylhet
HOTO DATE	2026-09-01	DISTRICT	Sunamganj
HANDOVER ORG	Dhaly Infratech	TAKEOVER ORG	Alliance Computers Limited
HANDOVER PERSON	Md Anwar	TAKEOVER PERSON	Md. Ismail Hossain
HANDOVER PHONE	01734713807	TAKEOVER PHONE	01847426858
INSPECTED BY	Ismail Siraji	SECURITY GUARD	Yes
ACCESS KEY HANDED OVER	Yes	SITE TYPE	Not Filled
BTS TYPE	Indoor		
SHARED WITH OPERATOR	No	SHARED OPERATOR NAME	—

GENERATOR INFORMATION

DG BRAND	SDMO	GENSET ASSET NO.	N/A
CAPACITY (KVA)	30	TYPE	Can
FUEL TANK CAPACITY	2000	PRESENT RH	2952.9
FUEL (NO WATER)	55 L	FUEL (TOTAL)	114 L
WATER AMOUNT	59 L	FUEL AMOUNT (WORD)	Fifty five litter
DG SITE TYPE	Remote	DG LOCKED AFTER FUELING	Yes
DG PRESENT STATUS	NOK	GENSET ON ALARM	NOK
BATTERY BRAND	Hamko	BATTERY SERIAL	P033XFDI0753
BATTERY AH	100	ENGINE SERIAL	3029DF120
ATS BRAND	JRC	ATS MODE	Auto
RH METER TYPE	Digital from controller	LAST SERVICE DATE	2026-05-29
KEY TYPE	Local Key	KEY STATUS — BTS	Local
KEY STATUS — DG ROOM	Local		

ACTIVE DG	1	CONNECTED FUEL TANKS	1
FAULTY/DISCONNECTED DG	0	FAULTY/DISCONNECTED TANKS	0

CONNECTED GENERATOR CHECKLIST & READINGS

ITEM	VALUE	ITEM	VALUE
Earth Connection OK	Yes	Load Current (A)	0
Frequency (Hz)	0	Phase	3 Phase
Output	0	Engine Brand	John Deere
Voltage L1-L2	0	Voltage L2-L3	0
Voltage L3-L1	0	Voltage L1-N	0
Voltage L2-N	0	Voltage L3-N	0
Current Line 1	0	Current Line 2	0
Current Line 3	0	N-G	0
Controller Status	OK	Black Smoke Status	NOK
DG Battery Charger	OK	ATS Physical & Functional Status	OK
DG Automation (VDTC/RVDTC/Rectifier) per BL Standard	NOK	Fuel Preserved at Safe & Appropriate Location	OK
Exhaust Fan / Ventilation Sufficient When Running	OK	Sufficient Water in Radiator & Battery	NOK
DG Radiator Condition	NOK	DG Battery Condition	NOK
DG Runs in Both Auto & Manual Mode	OK	GENSET ON Alarm Functioning Properly	NOK
Lub Oil Status (Level & Colour)	NOK	DG RH Meter Working Properly	OK
No Parts Missing (if missing, note in snags below)	OK		

SNAGS FOUND (6)

SNAG #	SYSTEM	CATEGORY	COMPONENT	STATUS	OBSERVATIONS	ACTION	PHOTO
S-136	General	—	DG (generator)	Faulty	DG marked 'Faulty' under Generator status during handover; all electrical readings (load current, frequency, voltage levels, output) recorded as 0. Remarks state 'DG Permanent Faulty'. (from paper HOTO checklist PDF, transcribed 2026-09-16)	Open	—
S-137	General	—	Black smoke status	Faulty	Marked NOK (from paper HOTO checklist PDF, transcribed 2026-09-16)	Open	—
S-138	General	—	Sufficient water in radiator/battery	Faulty	Marked NOK (from paper HOTO checklist PDF, transcribed 2026-09-16)	Open	—
S-139	General	—	DG radiator condition	Faulty	Marked NOK (from paper HOTO checklist PDF, transcribed 2026-09-16)	Open	—

S-140	General	—	DG running in Auto/Manual mode	Faulty	Marked NOK (from paper HOTO checklist PDF, transcribed 2026-09-16)	Open	—
S-141	General	—	Lub Oil Status	Faulty	Marked NOK (from paper HOTO checklist PDF, transcribed 2026-09-16)	Open	—

DEFICIENCIES & SAFETY REMARKS

DG MAJOR DEFICIENCIES	DG permanent faulty
SAFETY REMARKS	DG permanent faulty
GENERAL REMARKS	DG permanent faulty PDF checklist notes: This DG is recorded as permanently faulty (all electrical readings zero, multiple checklist items NOK: black smoke, radiator water, radiator condition, auto/manual running, lub oil). GENSET ON alarm row is annotated 'Not check' (not evaluated) rather than OK/NOK. Handover status row shows check marks near BOTH 'Completed' and 'Not Completed' boxes - genuinely ambiguous on the form; given the DG is noted permanently faulty, 'Not Completed' is more plausible but this should be verified by a human. RVDT annotation appears next to the DG automation row (context unclear).

SITE PHOTOS



Site / Nameplate



DG RH / Meter



Fuel Gauge




Additional




Additional



Additional



Additional



Additional



Additional



Additional

Md Anwar

Handed Over By · Dhaly Infratech
01734713807

Date: _____

Md. Ismail Hossain

Taken Over By · Alliance Computers
Limited
01847426858

Date: _____

BL Concern · Name / Signature

Date: _____

APPENDIX — PHOTO EVIDENCE (35)

Full-size reference photos for SYL_X0069, grouped by type and numbered for cross-reference against the tables above.

REQUIRED SITE PHOTOS (3)

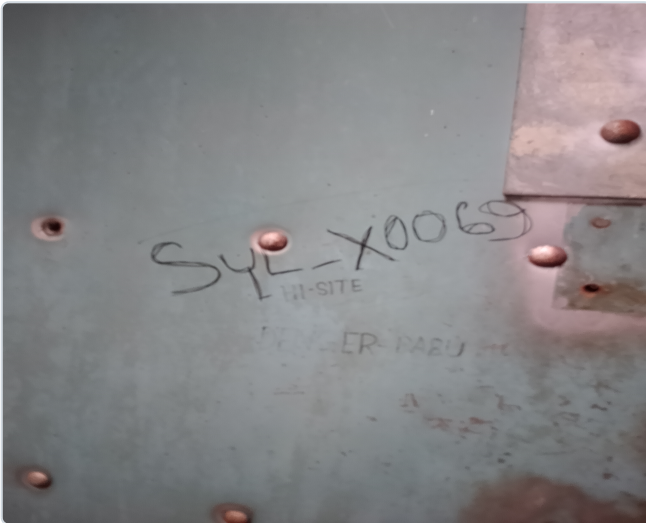


Photo 1 — Site / Nameplate



Photo 2 — DG RH / Meter



Photo 3 — Fuel Gauge

ADDITIONAL PHOTOS (32)



Photo 4 — Additional Photos 1



Photo 5 — Additional Photos 2



Photo 6 — Additional Photos 3

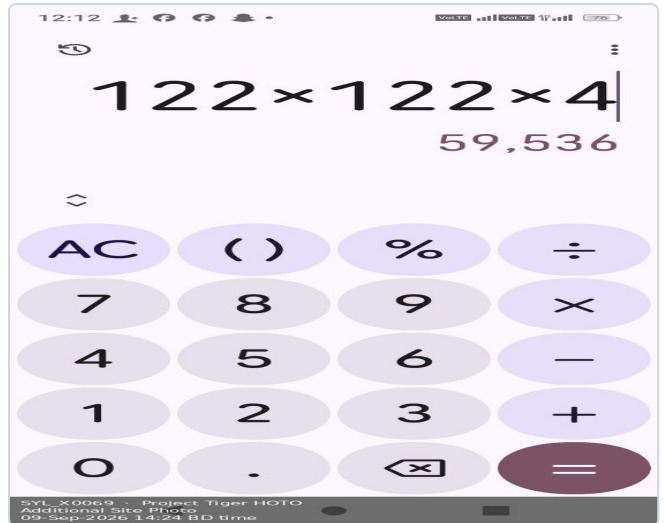


Photo 7 — Additional Photos 4

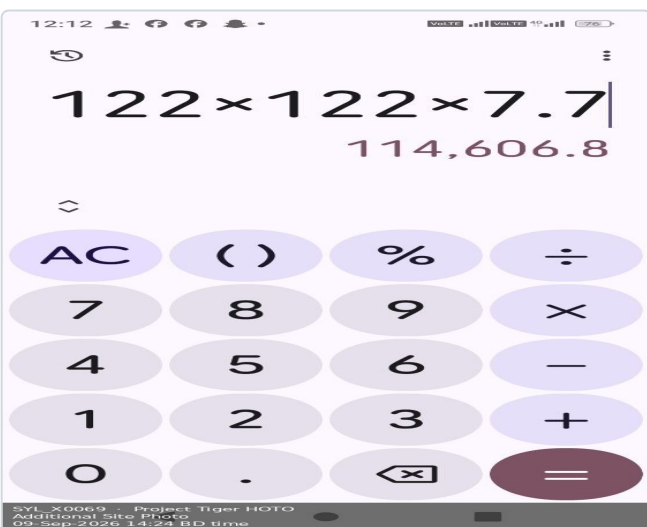


Photo 8 — Additional Photos 5



Photo 9 — Additional Photos 6



SYL_X0069 · Project Tiger HOTO
Additional Site Photo
09-Sep-2026 14:24 BD time

Photo 10 — Additional Photos 7



SYL_X0069 · Project Tiger HOTO
Additional Site Photo
09-Sep-2026 14:24 BD time

Photo 11 — Additional Photos 8



SYL_X0069 · Project Tiger HOTO
Additional Site Photo
09-Sep-2026 14:24 BD time

Photo 12 — Additional Photos 9



SYL_X0069 · Project Tiger HOTO
Additional Site Photo
09-Sep-2026 14:24 BD time

Photo 13 — Additional Photos 10



SYL_X0069 · Project Tiger HOTO
Additional Site Photo
09-Sep-2026 14:24 BD time

Photo 14 — Additional Photos 11



SYL_X0069 · Project Tiger HOTO
Additional Site Photo
09-Sep-2026 14:24 BD time

Photo 15 — Additional Photos 12

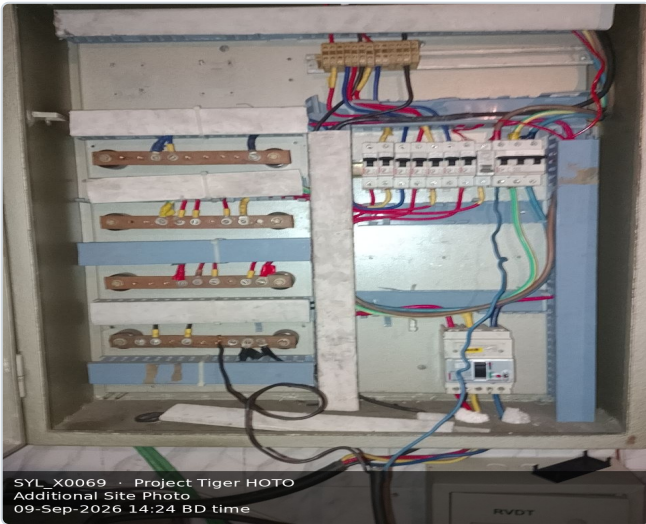


Photo 16 — Additional Photos 13



Photo 17 — Additional Photos 14



Photo 18 — Additional Photos 15

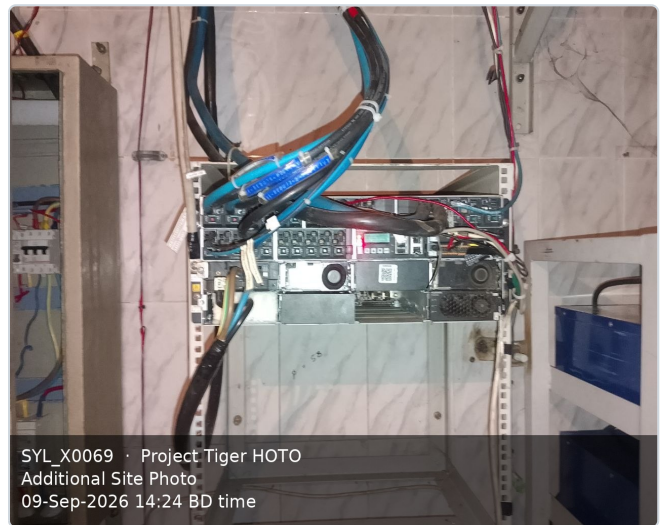


Photo 19 — Additional Photos 16

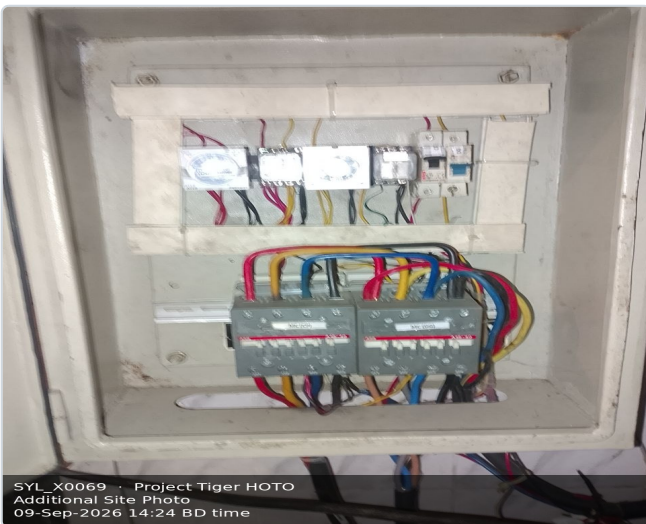


Photo 20 — Additional Photos 17

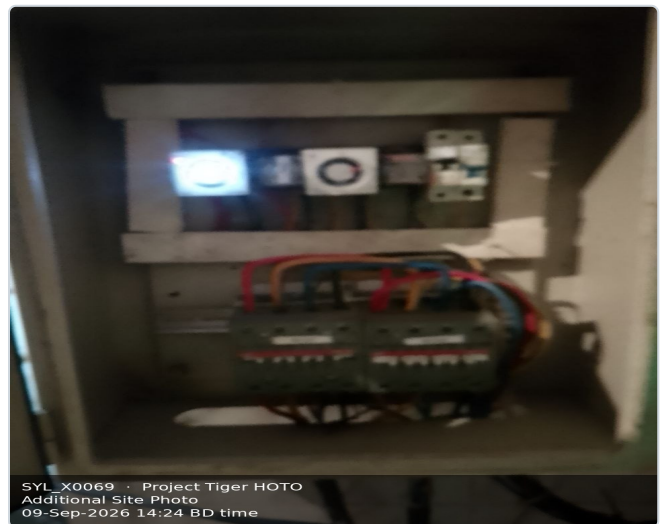


Photo 21 — Additional Photos 18



Photo 22 — Additional Photos 19



Photo 23 — Additional Photos 20

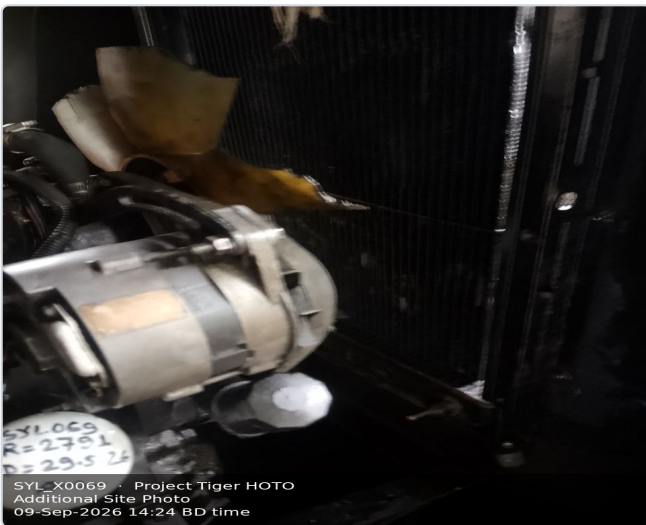


Photo 24 — Additional Photos 21



Photo 25 — Additional Photos 22

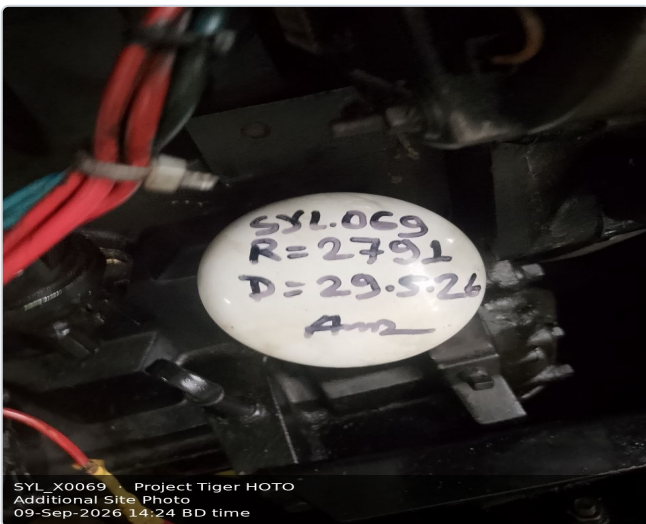


Photo 26 — Additional Photos 23



Photo 27 — Additional Photos 24



SYL_X0069 · Project Tiger HOTO
Additional Site Photo
09-Sep-2026 14:24 BD time

Photo 28 — Additional Photos 25




SYL_X0069 · Project Tiger HOTO
Additional Site Photo
09-Sep-2026 14:24 BD time

Photo 29 — Additional Photos 26



SYL_X0069 · Project Tiger HOTO
Additional Site Photo
09-Sep-2026 14:24 BD time

Photo 30 — Additional Photos 27

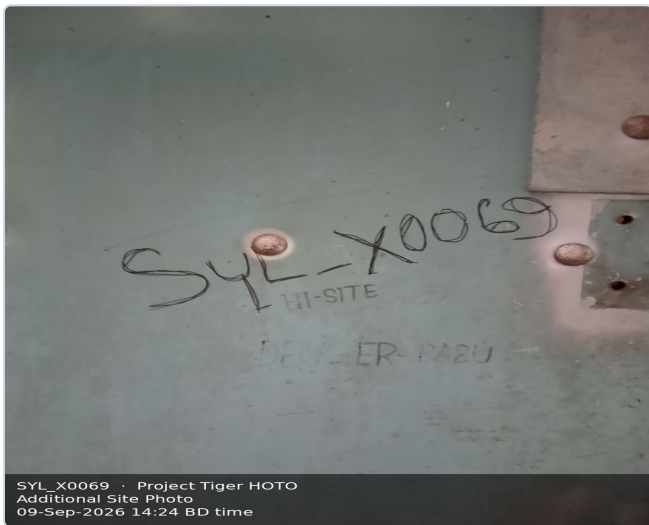

SYL_X0069 · Project Tiger HOTO
Additional Site Photo
09-Sep-2026 14:24 BD time

Photo 31 — Additional Photos 28



SYL_X0069 · Project Tiger HOTO
Additional Site Photo
09-Sep-2026 14:24 BD time

Photo 32 — Additional Photos 29



SYL_X0069 · Project Tiger HOTO
Additional Site Photo
09-Sep-2026 14:24 BD time

Photo 33 — Additional Photos 30



Photo 34 — Additional Photos 31



Photo 35 — Additional Photos 32