

Site HOTO Report — SYL_X0152

Project Tiger · Dhaly Infratech → Alliance Computers Limited · Generated 25-Oct-2026 21:54 BD time

100%

FORM COMPLETION

15/15

CHECKLIST OK

2

OPEN SNAGS

2

TOTAL SNAGS

39

PHOTOS ATTACHED

SITE & HANDOVER DETAILS

SITE CODE	SYL_X0152	ZONE	Sylhet
HOTO DATE	2026-09-04	DISTRICT	Sunamganj
HANDOVER ORG	Dhaly Infratech Ltd	TAKEOVER ORG	Alliance Computers Limited
HANDOVER PERSON	Md. Anwar	TAKEOVER PERSON	Md Ismail hossain.
HANDOVER PHONE	01734413807	TAKEOVER PHONE	01847426858
INSPECTED BY	Ismail Siraji	SECURITY GUARD	Yes
ACCESS KEY HANDED OVER	Yes	SITE TYPE	GFT
BTS TYPE	Indoor		
SHARED WITH OPERATOR	No	SHARED OPERATOR NAME	N/A

GENERATOR INFORMATION



DG BRAND	Tempest	GENSET ASSET NO.	N/A
CAPACITY (KVA)	13	TYPE	Can
FUEL TANK CAPACITY	2000	PRESENT RH	343.4
FUEL (NO WATER)	197 L	FUEL (TOTAL)	197 L
WATER AMOUNT	— L	FUEL AMOUNT (WORD)	One Hundred Ninety Seven Liters
DG SITE TYPE	Remote	DG LOCKED AFTER FUELING	Yes
DG PRESENT STATUS	OK	GENSET ON ALARM	OK
BATTERY BRAND	100	BATTERY SERIAL	12787308
BATTERY AH	100	ENGINE SERIAL	GN5732U939425V
ATS BRAND	Local	ATS MODE	Auto
RH METER TYPE	Digital from controller	LAST SERVICE DATE	2026-08-30
KEY TYPE	Local Key	KEY STATUS — BTS	Local
KEY STATUS — DG ROOM	Local		
ACTIVE DG	1	CONNECTED FUEL TANKS	1

FAULTY/DISCONNECTED DG	0	FAULTY/DISCONNECTED TANKS	0
------------------------	---	---------------------------	---

CONNECTED GENERATOR CHECKLIST & READINGS

ITEM	VALUE	ITEM	VALUE
Earth Connection OK	Yes	Load Current (A)	16
Frequency (Hz)	52	Phase	3 Phase
Output	390	Engine Brand	Perkins
Voltage L1-L2	385	Voltage L2-L3	385
Voltage L3-L1	386	Voltage L1-N	223
Voltage L2-N	222	Voltage L3-N	223
Current Line 1	8	Current Line 2	8
Current Line 3	0	N-G	5.59
Controller Status	OK	Black Smoke Status	OK
DG Battery Charger	OK	ATS Physical & Functional Status	OK
DG Automation (VDTC/RVDTC/Rectifier) per BL Standard	OK	Fuel Preserved at Safe & Appropriate Location	OK
Exhaust Fan / Ventilation Sufficient When Running	OK	Sufficient Water in Radiator & Battery	OK
DG Radiator Condition	OK	DG Battery Condition	OK
DG Runs in Both Auto & Manual Mode	OK	GENSET ON Alarm Functioning Properly	OK
Lub Oil Status (Level & Colour)	OK	DG RH Meter Working Properly	OK
No Parts Missing (if missing, note in snags below)	OK		

SNAGS FOUND (2)

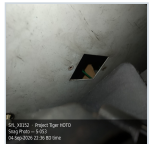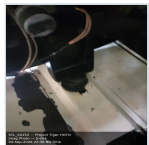
SNAG #	SYSTEM	CATEGORY	COMPONENT	STATUS	OBSERVATIONS	ACTION	PHOTO
S-053	DG	DG - Other	DG power breaker faulty	Faulty	—	Open	
S-054	DG	DG - Other	Engine mount broken	Faulty	—	Open	

DEFICIENCIES & SAFETY REMARKS

DG MAJOR DEFICIENCIES	DG breaker faulty; pillar mounting broken
SAFETY REMARKS	—

GENERAL REMARKS	PDF checklist notes: Site ID on form reads 'SYL-X0152' matching filename, confidence high. All main checklist rows (Controller Status through No parts missing) checked OK. DG last servicing date recorded as 30-8-26 (2026-08-30), and RH meter type marked as Digital from controller. Type (Can/Non-can) recorded as 'Can'. Fuel amount in words confirms 'one hundred ninety seven' liters, consistent with the 197 numeral. Voltage/current/frequency readings (L1-L2 385V, L2-L3 385V, L3-L1 386V, frequency 52Hz, currents 8/8/0A) were captured on the form but not requested in the target field list, included here only as engine_serial/misc context is not applicable - omitted from fields since not in requested schema. This site likely already has a submitted (non-placeholder) visit in the DB per task context; use these values only to fill gaps.
------------------------	--

SITE PHOTOS

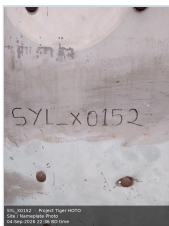 SYL-X0152 - Project Tiger HOTO DG RH / Meter Photo 04-Sep-2026 22:36 BD time	 Generator Controller Model 720 SYL-X0152 - Project Tiger HOTO DG RH / Meter Photo 04-Sep-2026 22:36 BD time	 SYL-X0152 - Project Tiger HOTO Additional Site Photo 04-Sep-2026 22:36 BD time		
 SYL-X0152 - Project Tiger HOTO Additional Site Photo 04-Sep-2026 22:36 BD time	 SYL-X0152 - Project Tiger HOTO Additional Site Photo 04-Sep-2026 22:36 BD time	 SYL-X0152 - Project Tiger HOTO Additional Site Photo 04-Sep-2026 22:36 BD time	 SYL-X0152 - Project Tiger HOTO Additional Site Photo 09-Sep-2026 14:25 BD time	 Generator Controller Model 720 SYL-X0152 - Project Tiger HOTO Additional Site Photo 09-Sep-2026 14:25 BD time

Md. Anwar Handed Over By · Dhaly Infratech Ltd 01734413807 Date: _____	Md Ismail hossain. Taken Over By · Alliance Computers Limited 01847426858 Date: _____	BL Concern · Name / Signature Date: _____
--	--	--

APPENDIX — PHOTO EVIDENCE (39)

Full-size reference photos for SYL_X0152, grouped by type and numbered for cross-reference against the tables above.

REQUIRED SITE PHOTOS (3)

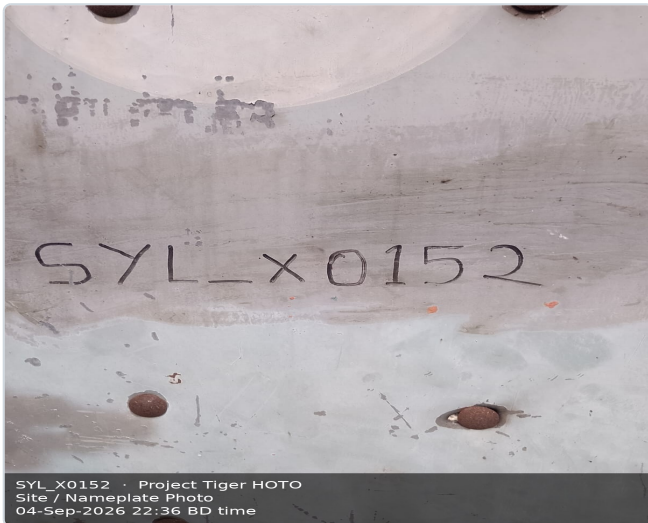


Photo 1 — Site / Nameplate



Photo 2 — DG RH / Meter



Photo 3 — Fuel Gauge

SNAG EVIDENCE PHOTOS (2)



Photo 4 — S-053 — DG power breaker faulty



Photo 5 — S-054 — Engine mountain broken

ADDITIONAL PHOTOS (34)

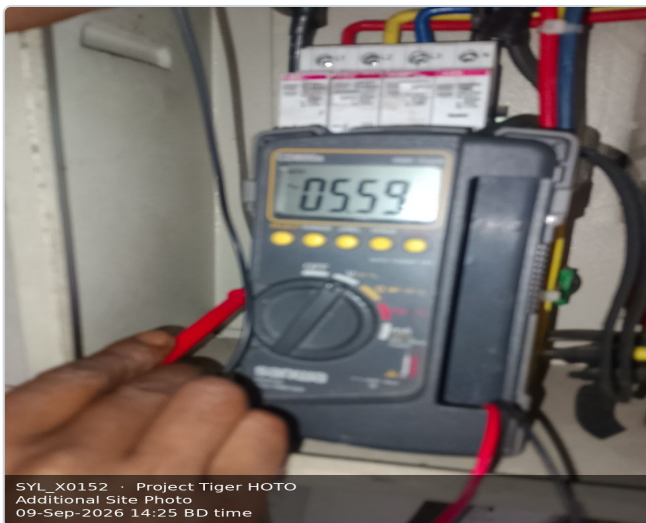


Photo 6 — Additional Photos 1

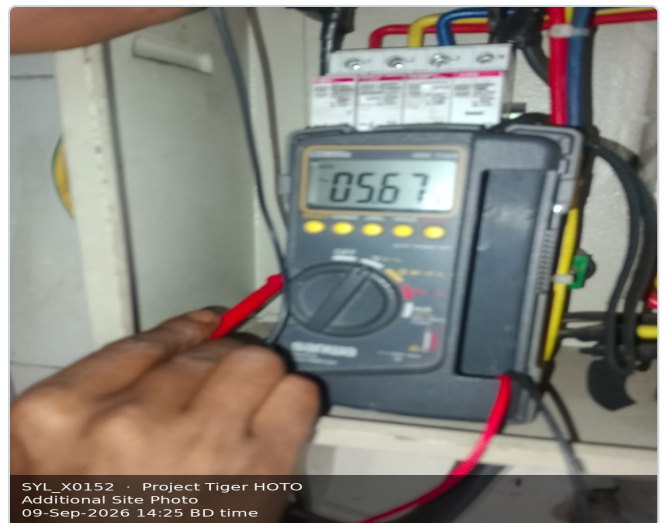


Photo 7 — Additional Photos 2

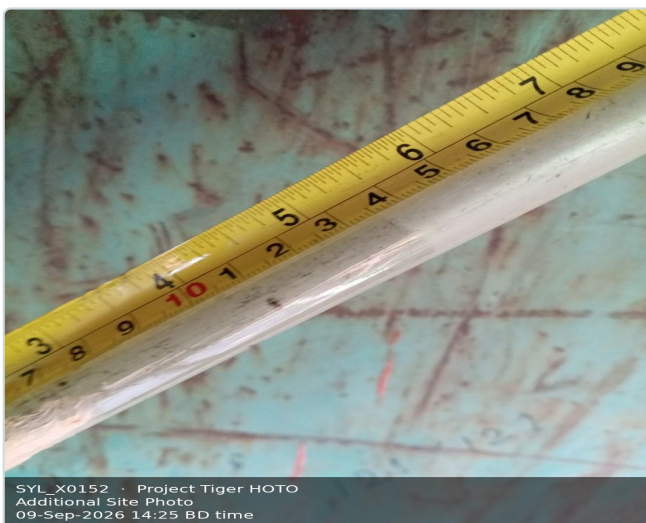


Photo 8 — Additional Photos 3



Photo 9 — Additional Photos 4

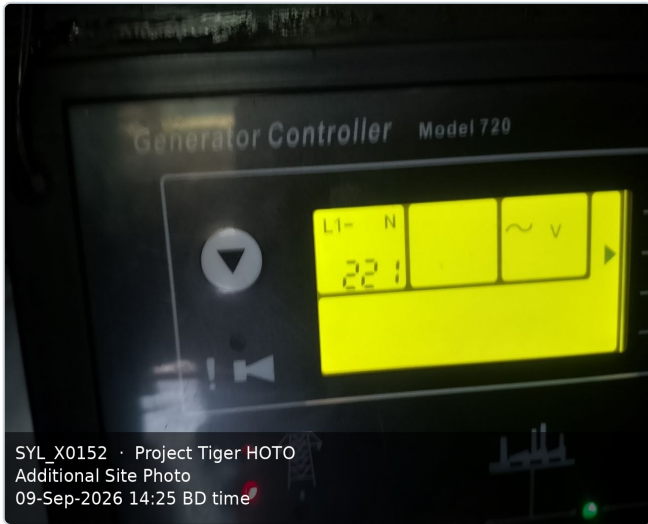


Photo 10 — Additional Photos 5

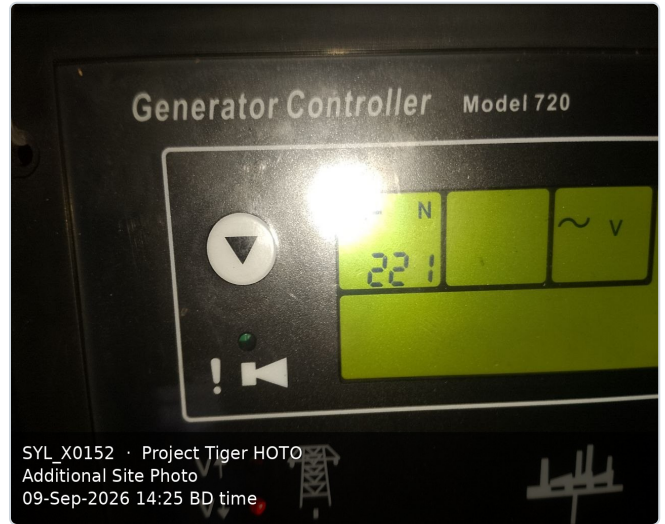


Photo 11 — Additional Photos 6

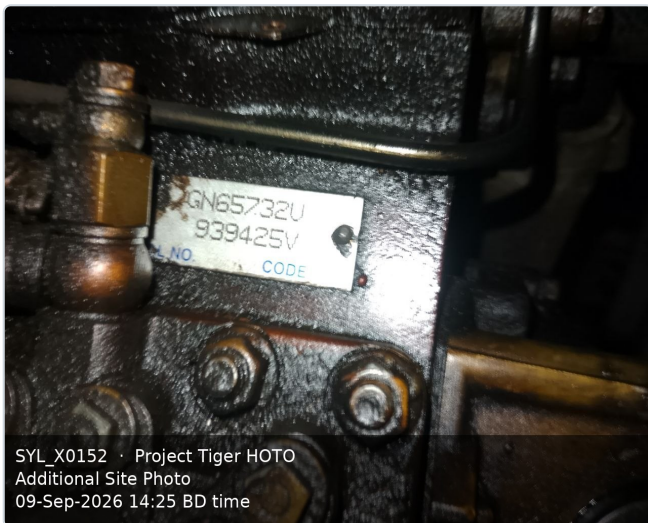


Photo 12 — Additional Photos 7

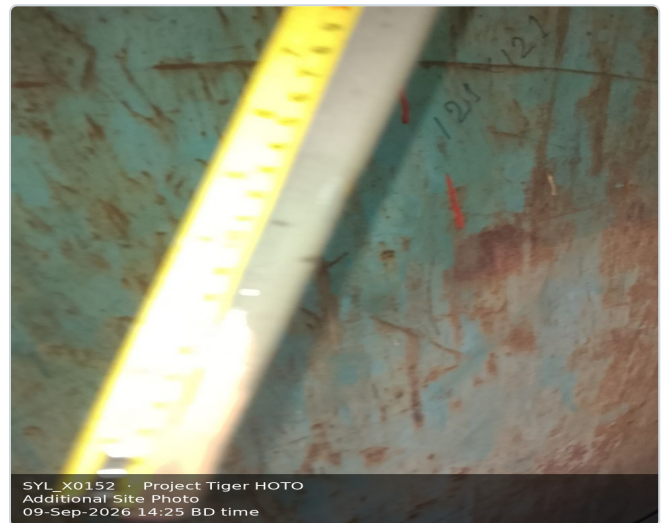


Photo 13 — Additional Photos 8



Photo 14 — Additional Photos 9



Photo 15 — Additional Photos 10



Photo 16 — Additional Photos 11



Photo 17 — Additional Photos 12

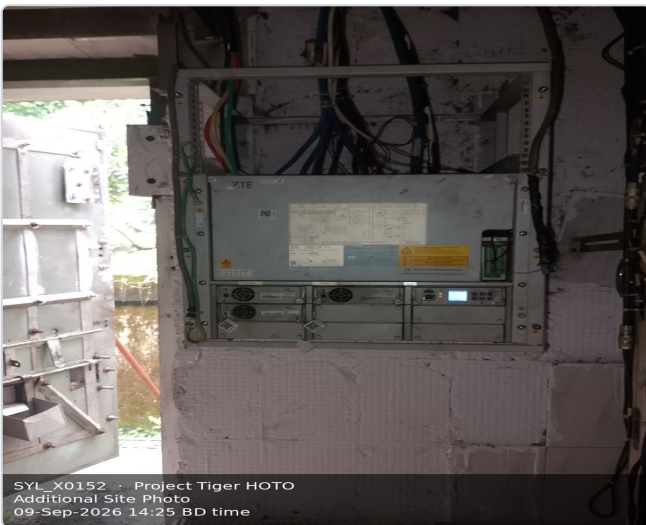


Photo 18 — Additional Photos 13

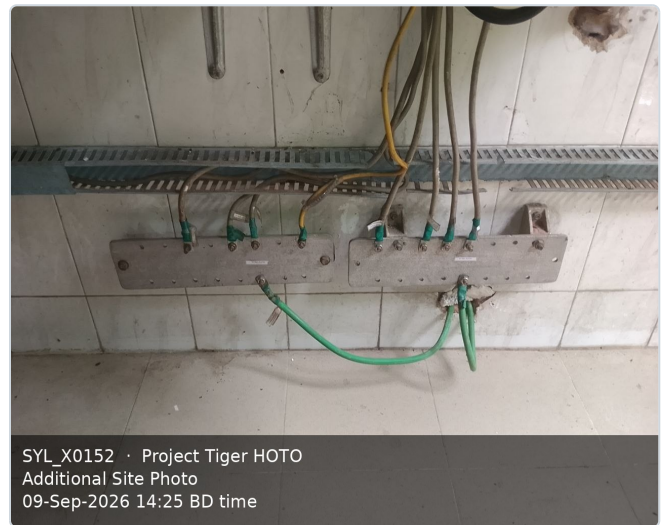


Photo 19 — Additional Photos 14



Photo 20 — Additional Photos 15

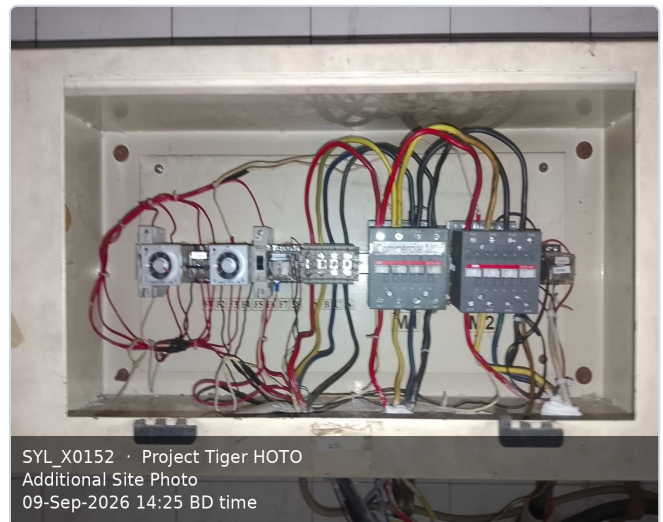


Photo 21 — Additional Photos 16

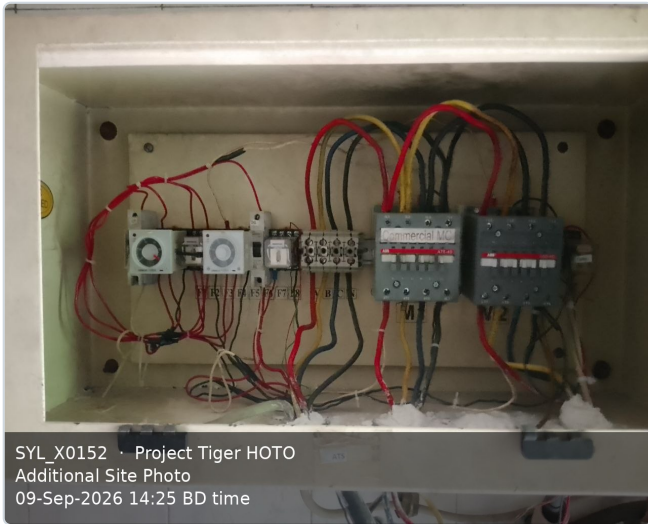


Photo 22 — Additional Photos 17



Photo 23 — Additional Photos 18



Photo 24 — Additional Photos 19



Photo 25 — Additional Photos 20

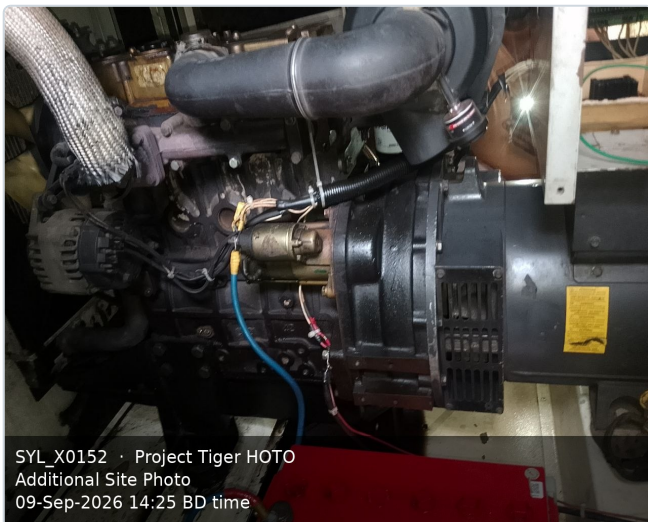


Photo 26 — Additional Photos 21

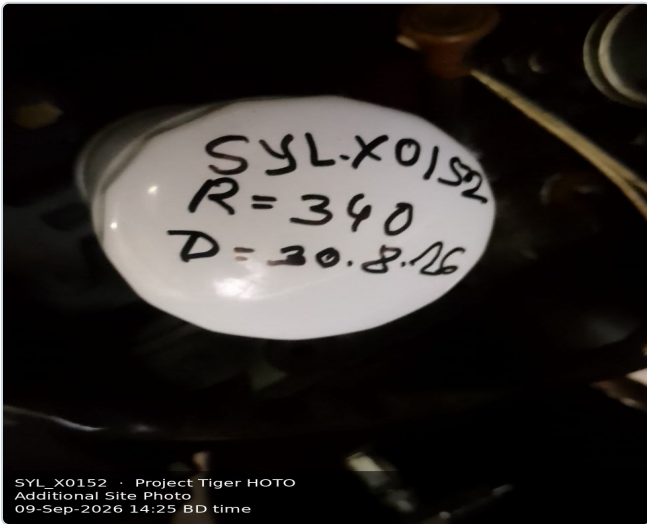


Photo 27 — Additional Photos 22



SYL_X0152 · Project Tiger HOTO
Additional Site Photo
09-Sep-2026 14:25 BD time

Photo 28 — Additional Photos 23



SYL_X0152 · Project Tiger HOTO
Additional Site Photo
09-Sep-2026 14:25 BD time

Photo 29 — Additional Photos 24




SYL_X0152 · Project Tiger HOTO
Additional Site Photo
09-Sep-2026 14:25 BD time

Photo 30 — Additional Photos 25



SYL_X0152 · Project Tiger HOTO
Additional Site Photo
09-Sep-2026 14:25 BD time

Photo 31 — Additional Photos 26

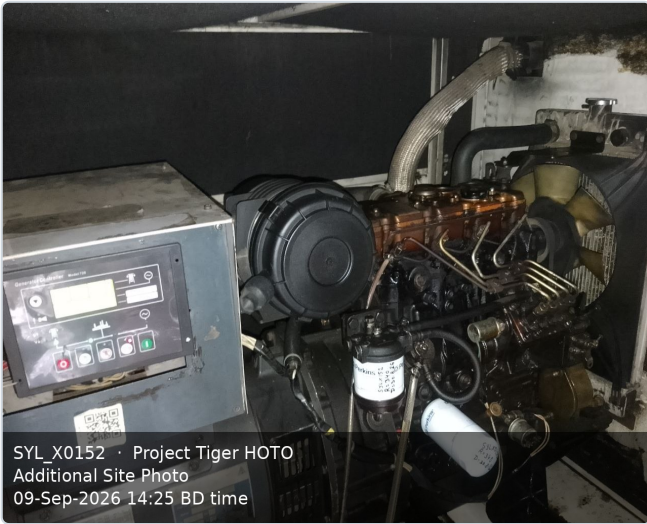

SYL_X0152 · Project Tiger HOTO
Additional Site Photo
09-Sep-2026 14:25 BD time

Photo 32 — Additional Photos 27



SYL_X0152 · Project Tiger HOTO
Additional Site Photo
09-Sep-2026 14:25 BD time

Photo 33 — Additional Photos 28



Photo 34 — Additional Photos 29

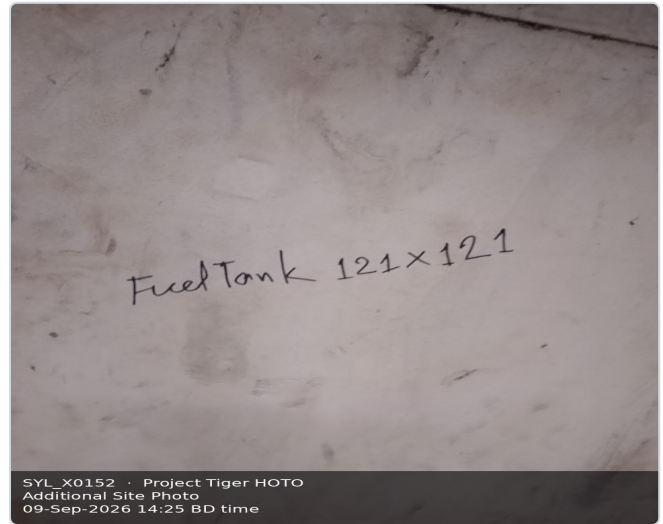


Photo 35 — Additional Photos 30



Photo 36 — Additional Photos 31



Photo 37 — Additional Photos 32

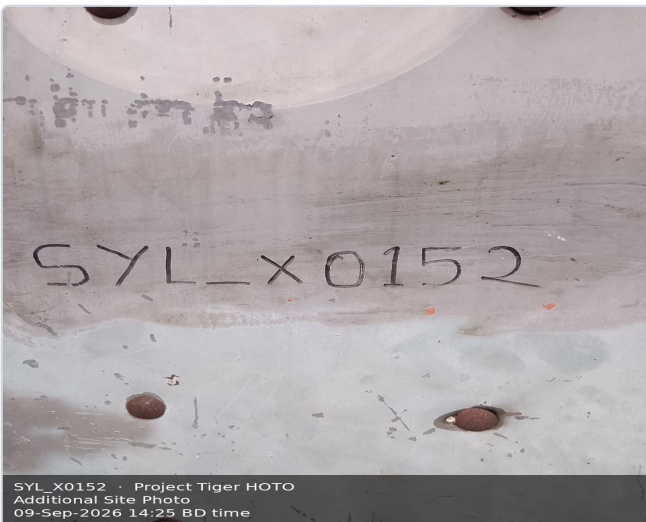


Photo 38 — Additional Photos 33



Photo 39 — Additional Photos 34