

Site HOTO Report — SYL_X0242

Project Tiger · Dhaly Infratech → Alliance Computers Limited · Generated 07-Sep-2026 20:53 BD time

100%

FORM COMPLETION

15/15

CHECKLIST OK

1

OPEN SNAGS

1

TOTAL SNAGS

4

PHOTOS ATTACHED

SITE & HANDOVER DETAILS

SITE CODE	SYL_X0242	ZONE	Sylhet
HOTO DATE	2026-09-02	DISTRICT	Sunamganj
HANDOVER ORG	Dhaly Infratech	TAKEOVER ORG	Alliance Computers Limited
HANDOVER PERSON	Md. Eidris Ali	TAKEOVER PERSON	Md. Ismail Hossain
HANDOVER PHONE	01750537433	TAKEOVER PHONE	01847426858
INSPECTED BY	Ismail Siraji	SECURITY GUARD	Yes
ACCESS KEY HANDED OVER	Yes	SITE TYPE	GF-RT
BTS TYPE	Indoor		
SHARED WITH OPERATOR	No	SHARED OPERATOR NAME	N/A

GENERATOR INFORMATION

DG BRAND	FG Wilson	GENSET ASSET NO.	2001001IB87
CAPACITY (KVA)	22	TYPE	Can
FUEL TANK CAPACITY	2000	PRESENT RH	2635.2
FUEL (NO WATER)	104 L	FUEL (TOTAL)	104 L
WATER AMOUNT	— L	FUEL AMOUNT (WORD)	One Hundred Four Liters
DG SITE TYPE	Standard	DG LOCKED AFTER FUELING	Yes
DG PRESENT STATUS	OK	GENSET ON ALARM	OK
BATTERY BRAND	Hamko	BATTERY SERIAL	P033XJB0375
BATTERY AH	100	ENGINE SERIAL	HP35203U912565P
ATS BRAND	Galaxy	ATS MODE	Auto
RH METER TYPE	Digital from controller	LAST SERVICE DATE	2026-06-24
KEY TYPE	Local Key	KEY STATUS — BTS	Local
KEY STATUS — DG ROOM	Local		
ACTIVE DG	1	CONNECTED FUEL TANKS	1
FAULTY/DISCONNECTED DG	—	FAULTY/DISCONNECTED TANKS	—

CONNECTED GENERATOR CHECKLIST & READINGS

ITEM	VALUE	ITEM	VALUE
Earth Connection OK	Yes	Load Current (A)	32
Frequency (Hz)	52	Phase	3 Phase
Output	410	Engine Brand	Perkins
Voltage L1-L2	410	Voltage L2-L3	408
Voltage L3-L1	410	Voltage L1-N	235
Voltage L2-N	235	Voltage L3-N	232
Current Line 1	14	Current Line 2	9
Current Line 3	9	N-G	1.33
Controller Status	OK	Black Smoke Status	OK
DG Battery Charger	OK	ATS Physical & Functional Status	OK
DG Automation (VDTC/RVDTC/Rectifier) per BL Standard	OK	Fuel Preserved at Safe & Appropriate Location	OK
Exhaust Fan / Ventilation Sufficient When Running	OK	Sufficient Water in Radiator & Battery	OK
DG Radiator Condition	OK	DG Battery Condition	OK
DG Runs in Both Auto & Manual Mode	OK	GENSET ON Alarm Functioning Properly	OK
Lub Oil Status (Level & Colour)	OK	DG RH Meter Working Properly	OK
No Parts Missing (if missing, note in snags below)	OK		


SNAGS FOUND (1)

SNAG #	SYSTEM	CATEGORY	COMPONENT	STATUS	OBSERVATIONS	ACTION	PHOTO
S-012	DG	DG - Mechanical/Fuel	Lube Oil Shortage	Faulty	—	Open	

DEFICIENCIES & SAFETY REMARKS

DG MAJOR DEFICIENCIES	—
SAFETY REMARKS	—
GENERAL REMARKS	—

SITE PHOTOS

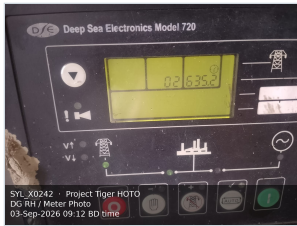 Site / Nameplate	 DG RH / Meter	 Fuel Gauge
---	--	---

Md. Eidris Ali

Handed Over By · Dhaly Infratech
01750537433

Date: _____

Md. Ismail Hossain

Taken Over By · Alliance Computers
Limited
01847426858

Date: _____

BL Concern · Name / Signature

Date: _____

APPENDIX — PHOTO EVIDENCE (4)

Full-size reference photos for SYL_X0242, grouped by type and numbered for cross-reference against the tables above.

REQUIRED SITE PHOTOS (3)



Photo 1 — Site / Nameplate

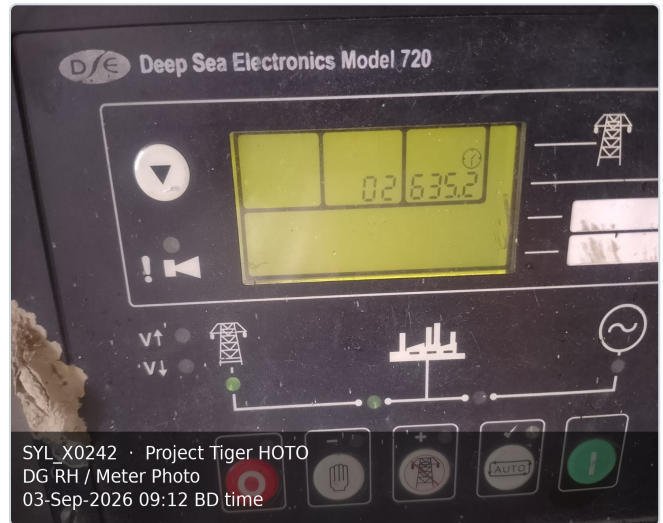


Photo 2 — DG RH / Meter



Photo 3 — Fuel Gauge

SNAG EVIDENCE PHOTOS (1)



Photo 4 — S-012 — Lube Oil Shortage