

Site HOTO Report — SYL_X0191

Project Tiger · Dhaly Infratech → Alliance Computers Limited · Generated 09-Sep-2026 00:10 BD time

100%

FORM COMPLETION

14/15

CHECKLIST OK

3

OPEN SNAGS

3

TOTAL SNAGS

6

PHOTOS ATTACHED

SITE & HANDOVER DETAILS

SITE CODE	SYL_X0191	ZONE	Sylhet
HOTO DATE	2026-09-05	DISTRICT	Sunamganj
HANDOVER ORG	Dhaly Infratech	TAKEOVER ORG	Alliance Computers Limited
HANDOVER PERSON	Md. Anwae	TAKEOVER PERSON	Md. Ismail Hossain
HANDOVER PHONE	01734713807	TAKEOVER PHONE	01847426858
INSPECTED BY	Ismail Siraji	SECURITY GUARD	No
ACCESS KEY HANDED OVER	Yes	SITE TYPE	GFT
BTS TYPE	Indoor		
SHARED WITH OPERATOR	No	SHARED OPERATOR NAME	N/A

GENERATOR INFORMATION

DG BRAND	FG Wilson	GENSET ASSET NO.	N/A
CAPACITY (KVA)	22	TYPE	Can
FUEL TANK CAPACITY	2000	PRESENT RH	15796.7
FUEL (NO WATER)	241 L	FUEL (TOTAL)	241 L
WATER AMOUNT	— L	FUEL AMOUNT (WORD)	Two Hundred Forty One Liters
DG SITE TYPE	Remote	DG LOCKED AFTER FUELING	Yes
DG PRESENT STATUS	OK	GENSET ON ALARM	OK
BATTERY BRAND	Lucas	BATTERY SERIAL	4362597
BATTERY AH	80	ENGINE SERIAL	HP511090U981933P
ATS BRAND	Genthe	ATS MODE	Auto
RH METER TYPE	Digital from controller	LAST SERVICE DATE	2026-04-30
KEY TYPE	Local Key	KEY STATUS — BTS	Local
KEY STATUS — DG ROOM	Local		
ACTIVE DG	1	CONNECTED FUEL TANKS	1

FAULTY/DISCONNECTED DG	—	FAULTY/DISCONNECTED TANKS	—
------------------------	---	---------------------------	---

CONNECTED GENERATOR CHECKLIST & READINGS

ITEM	VALUE	ITEM	VALUE
Earth Connection OK	Yes	Load Current (A)	45
Frequency (Hz)	51.2	Phase	3 Phase
Output	393	Engine Brand	Perkins
Voltage L1-L2	391	Voltage L2-L3	393
Voltage L3-L1	393	Voltage L1-N	227
Voltage L2-N	227	Voltage L3-N	227
Current Line 1	15	Current Line 2	15
Current Line 3	15	N-G	2.23
Controller Status	OK	Black Smoke Status	OK
DG Battery Charger	OK	ATS Physical & Functional Status	OK
DG Automation (VDTC/RVDTC/Rectifier) per BL Standard	OK	Fuel Preserved at Safe & Appropriate Location	OK
Exhaust Fan / Ventilation Sufficient When Running	OK	Sufficient Water in Radiator & Battery	OK
DG Radiator Condition	OK	DG Battery Condition	OK
DG Runs in Both Auto & Manual Mode	OK	GENSET ON Alarm Functioning Properly	OK
Lub Oil Status (Level & Colour)	NOK	DG RH Meter Working Properly	OK
No Parts Missing (if missing, note in snags below)	OK		

SNAGS FOUND (3)

SNAG #	SYSTEM	CATEGORY	COMPONENT	STATUS	OBSERVATIONS	ACTION	PHOTO
S-060	DG	DG - Other	Lube oil level is low	Faulty	—	Open	
S-061	DG	DG - Other	MC 1 pole faulty	Faulty	—	Open	
S-062	DG	DG - Other	Need Overhaling	Faulty	—	Open	

DEFICIENCIES & SAFETY REMARKS

DG MAJOR DEFICIENCIES	—
SAFETY REMARKS	—
GENERAL REMARKS	—

SITE PHOTOS



Site / Nameplate



DG RH / Meter



Fuel Gauge

Md. Anwae

Handed Over By · Dhaly Infratech
01734713807

Date: _____

Md. Ismail Hossain

Taken Over By · Alliance Computers
Limited
01847426858

Date: _____

BL Concern · Name / Signature

Date: _____

APPENDIX — PHOTO EVIDENCE (6)

Full-size reference photos for SYL_X0191, grouped by type and numbered for cross-reference against the tables above.

REQUIRED SITE PHOTOS (3)

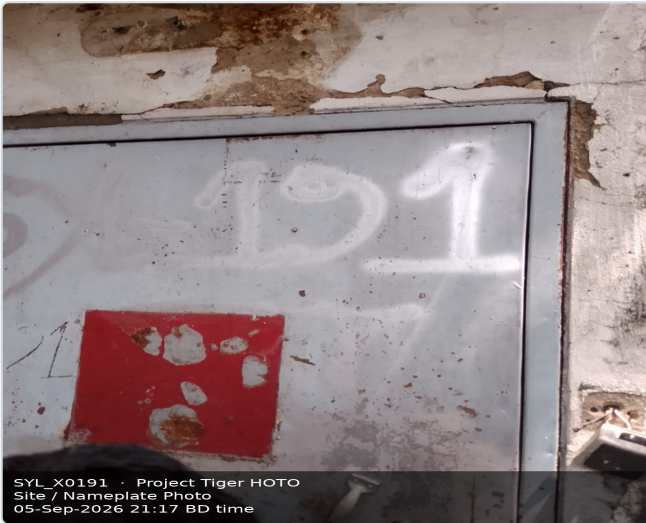


Photo 1 — Site / Nameplate



Photo 2 — DG RH / Meter



Photo 3 — Fuel Gauge

SNAG EVIDENCE PHOTOS (3)

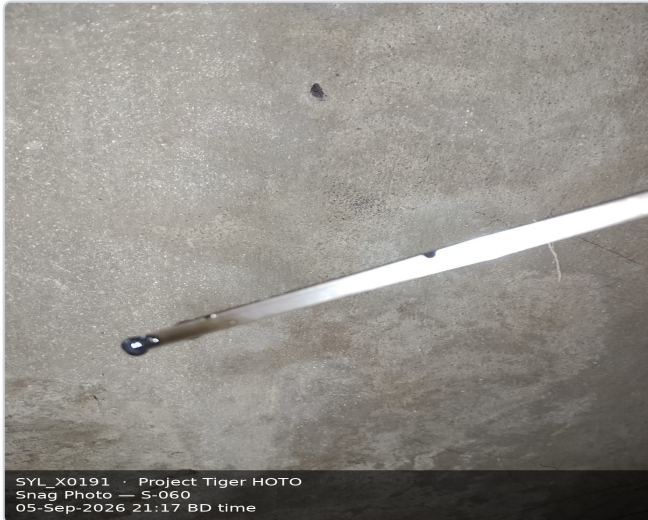


Photo 4 — S-060 — Lube oil level is low

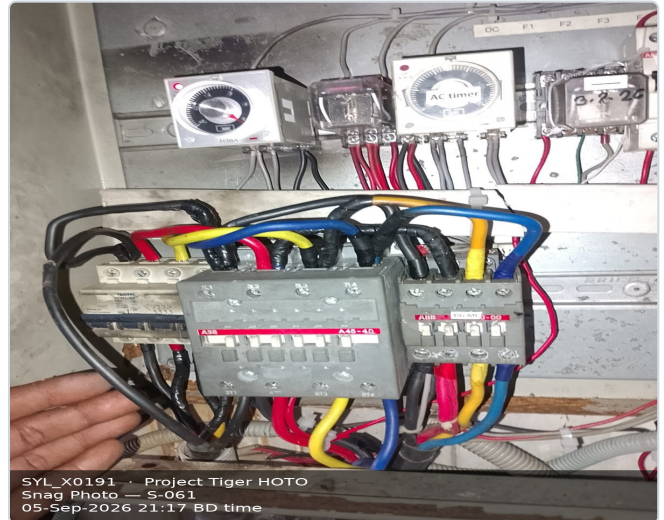


Photo 5 — S-061 — MC 1 pole faulty



Photo 6 — S-062 — Need Overhaling