

Site HOTO Report — SYL_G0420

Project Tiger · Dhaly Infratech → Alliance Computers Limited · Generated 09-Sep-2026 00:10 BD time

100%

FORM COMPLETION

14/15

CHECKLIST OK

1

OPEN SNAGS

1

TOTAL SNAGS

4

PHOTOS ATTACHED

SITE & HANDOVER DETAILS

SITE CODE	SYL_G0420	ZONE	Sylhet
HOTO DATE	2026-09-01	DISTRICT	Sunamganj
HANDOVER ORG	Dhaly Infratech	TAKEOVER ORG	Alliance Computers Limited
HANDOVER PERSON	Md. Anwar	TAKEOVER PERSON	Md. Ismail Hossain
HANDOVER PHONE	01734713807	TAKEOVER PHONE	01847426858
INSPECTED BY	Ismail Siraji	SECURITY GUARD	Yes
ACCESS KEY HANDED OVER	Yes	SITE TYPE	GF-RT
BTS TYPE	Indoor		
SHARED WITH OPERATOR	Yes	SHARED OPERATOR NAME	Grameen Phone

GENERATOR INFORMATION

DG BRAND	Tempest	GENSET ASSET NO.	N/A
CAPACITY (KVA)	22	TYPE	Can
FUEL TANK CAPACITY	2000	PRESENT RH	3498.4
FUEL (NO WATER)	178 L	FUEL (TOTAL)	297 L
WATER AMOUNT	119 L	FUEL AMOUNT (WORD)	One Hundred Seventy Eight Li
DG SITE TYPE	Remote	DG LOCKED AFTER FUELING	—
DG PRESENT STATUS	OK	GENSET ON ALARM	OK
BATTERY BRAND	Volvo	BATTERY SERIAL	3A15VOI12787308
BATTERY AH	—	ENGINE SERIAL	GNG65732U939425V
ATS BRAND	—	ATS MODE	—
RH METER TYPE	—	LAST SERVICE DATE	—
KEY TYPE	Local Key	KEY STATUS — BTS	Local
KEY STATUS — DG ROOM	Open		
ACTIVE DG	1	CONNECTED FUEL TANKS	1

FAULTY/DISCONNECTED DG	—	FAULTY/DISCONNECTED TANKS	—
------------------------	---	---------------------------	---

CONNECTED GENERATOR CHECKLIST & READINGS

ITEM	VALUE	ITEM	VALUE
Earth Connection OK	Yes	Load Current (A)	24
Frequency (Hz)	49	Phase	3 Phase
Output	400	Engine Brand	Perkins
Voltage L1-L2	398	Voltage L2-L3	398
Voltage L3-L1	400	Voltage L1-N	229
Voltage L2-N	229	Voltage L3-N	230
Current Line 1	12	Current Line 2	13
Current Line 3	0	N-G	.057
Controller Status	OK	Black Smoke Status	OK
DG Battery Charger	OK	ATS Physical & Functional Status	OK
DG Automation (VDTC/RVDTC/Rectifier) per BL Standard	OK	Fuel Preserved at Safe & Appropriate Location	OK
Exhaust Fan / Ventilation Sufficient When Running	OK	Sufficient Water in Radiator & Battery	OK
DG Radiator Condition	NOK	DG Battery Condition	OK
DG Runs in Both Auto & Manual Mode	OK	GENSET ON Alarm Functioning Properly	OK
Lub Oil Status (Level & Colour)	OK	DG RH Meter Working Properly	OK
No Parts Missing (if missing, note in snags below)	OK		


SNAGS FOUND (1)

SNAG #	SYSTEM	CATEGORY	COMPONENT	STATUS	OBSERVATIONS	ACTION	PHOTO
S-009	DG	DG - Other	Radiator fully block dust	Faulty	—	Open	


DEFICIENCIES & SAFETY REMARKS

DG MAJOR DEFICIENCIES	—
SAFETY REMARKS	—
GENERAL REMARKS	1) Hedgasket problem 2) Rediator jum/ not cilin

SITE PHOTOS

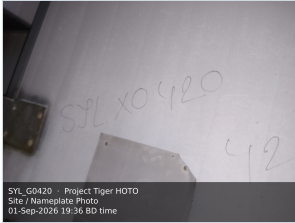

Site / Nameplate

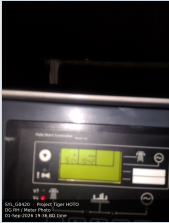

DG RH / Meter



Fuel Gauge

Md. Anwar

Handed Over By · Dhaly Infratech
01734713807

Date: _____

Md. Ismail Hossain

Taken Over By · Alliance Computers
Limited
01847426858

Date: _____

BL Concern · Name / Signature

Date: _____

APPENDIX — PHOTO EVIDENCE (4)

Full-size reference photos for SYL_G0420, grouped by type and numbered for cross-reference against the tables above.

REQUIRED SITE PHOTOS (3)

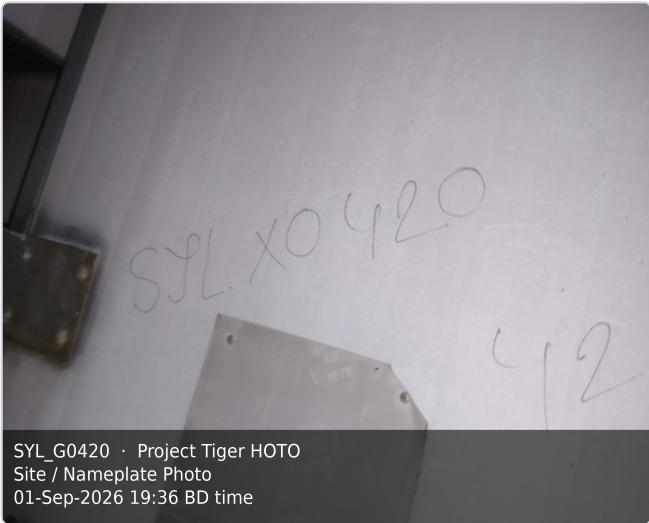


Photo 1 — Site / Nameplate



Photo 2 — DG RH / Meter



Photo 3 — Fuel Gauge

SNAG EVIDENCE PHOTOS (1)



Photo 4 — S-009 — Radiator fully block dust