

Site HOTO Report — SYL_X0615

Project Tiger · Dhaly Infratech → Alliance Computers Limited · Generated 07-Sep-2026 20:23 BD time

73%

FORM COMPLETION

0/0

CHECKLIST OK

2

OPEN SNAGS

2

TOTAL SNAGS

16

PHOTOS ATTACHED

Incomplete: the following expected fields were left blank in this submission — Site Type, BTS Type, Site Sharing.

SITE & HANDOVER DETAILS

SITE CODE	SYL_X0615	ZONE	Sylhet
HOTO DATE	2026-09-02	DISTRICT	Moulavibazar
HANDOVER ORG	Dhaly Infratech	TAKEOVER ORG	Alliance Computers Limited
HANDOVER PERSON	Sayed	TAKEOVER PERSON	Sourav
HANDOVER PHONE	0171633217	TAKEOVER PHONE	01847426870
INSPECTED BY	sourov sarkar	SECURITY GUARD	Yes
ACCESS KEY HANDED OVER	—	SITE TYPE	Not Filled
BTS TYPE	Not Filled		
SHARED WITH OPERATOR	Not Filled	SHARED OPERATOR NAME	—

GENERATOR INFORMATION

DG BRAND	Mets	GENSET ASSET NO.	No
CAPACITY (KVA)	22	TYPE	Can
FUEL TANK CAPACITY	2000	PRESENT RH	312
FUEL (NO WATER)	282 L	FUEL (TOTAL)	297 L
WATER AMOUNT	12 L	FUEL AMOUNT (WORD)	Two Hundred Ninety Seven Liters
DG SITE TYPE	Standard	DG LOCKED AFTER FUELING	Yes
DG PRESENT STATUS	OK	GENSET ON ALARM	OK
BATTERY BRAND	Hamko	BATTERY SERIAL	P033XJB0052
BATTERY AH	100	ENGINE SERIAL	N844L2216N5330
ATS BRAND	Local	ATS MODE	Auto
RH METER TYPE	Digital from controller	LAST SERVICE DATE	2026-07-25
KEY TYPE	Master Key - Abloy	KEY STATUS — BTS	ODC
KEY STATUS — DG ROOM	Open space		

ACTIVE DG	1	CONNECTED FUEL TANKS	1
FAULTY/DISCONNECTED DG	—	FAULTY/DISCONNECTED TANKS	—

CONNECTED GENERATOR CHECKLIST & READINGS

ITEM	VALUE	ITEM	VALUE
Earth Connection OK	Yes	Load Current (A)	25
Frequency (Hz)	51.2	Phase	3 Phase
Output	25	Voltage L1-L2	399
Voltage L2-L3	400	Voltage L3-L1	398
Voltage L1-N	230	Voltage L2-N	231
Voltage L3-N	240	Current Line 1	8
Current Line 2	9	Current Line 3	8
Engine Brand	Perkins		

SNAGS FOUND (2)

SNAG #	SYSTEM	CATEGORY	COMPONENT	STATUS	OBSERVATIONS	ACTION	PHOTO
S-010	DG	DG - Other	Fuel Pipe ([] [] [] [] [] [])	Faulty	—	Open	
S-011	DG	DG - Other	Need to fuel pipe protection for fuel save	Faulty	—	Open	

DEFICIENCIES & SAFETY REMARKS

DG MAJOR DEFICIENCIES	—
SAFETY REMARKS	—
GENERAL REMARKS	—

SITE PHOTOS

		
Site / Nameplate	DG RH / Meter	Fuel Gauge



Additional



Additional



Additional



Additional



Add

Sayed

Handed Over By · Dhaly Infratech
0171633217

Date: _____

Sourav

Taken Over By · Alliance Computers
Limited
01847426870

Date: _____

BL Concern · Name / Signature

Date: _____

APPENDIX — PHOTO EVIDENCE (16)

Full-size reference photos for SYL_X0615, grouped by type and numbered for cross-reference against the tables above.

REQUIRED SITE PHOTOS (3)



Photo 1 — Site / Nameplate



Photo 2 — DG RH / Meter



Photo 3 — Fuel Gauge

SNAG EVIDENCE PHOTOS (2)



Photo 4 — S-010 — Fuel Pipe ()



Photo 5 — S-011 — Need to fuel pipe protection for fuel save

ADDITIONAL PHOTOS (11)



Photo 6 — Site Context 1



Photo 7 — Site Context 2



Photo 8 — Site Context 3



Photo 9 — Site Context 4



Photo 10 — Site Context 5



Photo 11 — Site Context 6



Photo 12 — Site Context 7

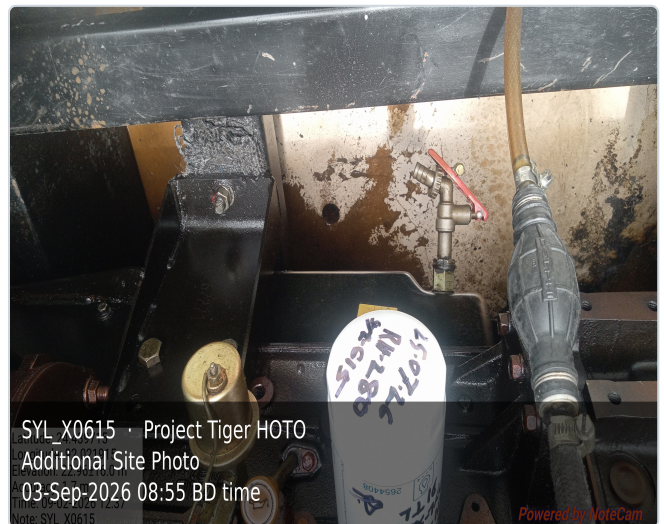


Photo 13 — Site Context 8



Photo 14 — Site Context 9



Photo 15 — Site Context 10



Photo 16 — Site Context 11