

Site HOTO Report — SYL_X0611

Project Tiger · Dhaly Infratech → Alliance Computers Limited · Generated 09-Sep-2026 00:10 BD time

100%

FORM COMPLETION

15/15

CHECKLIST OK

0

OPEN SNAGS

0

TOTAL SNAGS

3

PHOTOS ATTACHED

SITE & HANDOVER DETAILS

SITE CODE	SYL_X0611	ZONE	Sylhet
HOTO DATE	2026-09-02	DISTRICT	Sunamganj
HANDOVER ORG	Dhaly Infratech Ltd	TAKEOVER ORG	Alliance Computers Limited
HANDOVER PERSON	Md. Eidris Ali	TAKEOVER PERSON	Md. Ismail Hossain
HANDOVER PHONE	01750537433	TAKEOVER PHONE	01847426858
INSPECTED BY	Ismail Siraji	SECURITY GUARD	Yes
ACCESS KEY HANDED OVER	Yes	SITE TYPE	GFT
BTS TYPE	Outdoor		
SHARED WITH OPERATOR	No	SHARED OPERATOR NAME	N/A

GENERATOR INFORMATION

DG BRAND	FG Wilson	GENSET ASSET NO.	1003001QKE2
CAPACITY (KVA)	30	TYPE	Can
FUEL TANK CAPACITY	850	PRESENT RH	303.2
FUEL (NO WATER)	66 L	FUEL (TOTAL)	122 L
WATER AMOUNT	56 L	FUEL AMOUNT (WORD)	One Hundred Twenty Two Liters
DG SITE TYPE	Remote	DG LOCKED AFTER FUELING	Yes
DG PRESENT STATUS	OK	GENSET ON ALARM	OK
BATTERY BRAND	Hamko	BATTERY SERIAL	P033WIDE0636
BATTERY AH	100	ENGINE SERIAL	DJ32015*S009835C
ATS BRAND	Local	ATS MODE	Auto
RH METER TYPE	Digital from controller	LAST SERVICE DATE	2026-03-22
KEY TYPE	Local Key	KEY STATUS — BTS	Open
KEY STATUS — DG ROOM	Open		
ACTIVE DG	1	CONNECTED FUEL TANKS	1

FAULTY/DISCONNECTED DG	—	FAULTY/DISCONNECTED TANKS	—
------------------------	---	---------------------------	---

CONNECTED GENERATOR CHECKLIST & READINGS

ITEM	VALUE	ITEM	VALUE
Earth Connection OK	Yes	Load Current (A)	33
Frequency (Hz)	50.8	Phase	3 Phase
Output	418	Engine Brand	Parkings
Voltage L1-L2	415	Voltage L2-L3	416
Voltage L3-L1	415	Voltage L1-N	238
Voltage L2-N	237	Voltage L3-N	237
Current Line 1	11	Current Line 2	11
Current Line 3	11	N-G	1.32
Controller Status	OK	Black Smoke Status	OK
DG Battery Charger	OK	ATS Physical & Functional Status	OK
DG Automation (VDTC/RVDTC/Rectifier) per BL Standard	OK	Fuel Preserved at Safe & Appropriate Location	OK
Exhaust Fan / Ventilation Sufficient When Running	OK	Sufficient Water in Radiator & Battery	OK
DG Radiator Condition	OK	DG Battery Condition	OK
DG Runs in Both Auto & Manual Mode	OK	GENSET ON Alarm Functioning Properly	OK
Lub Oil Status (Level & Colour)	OK	DG RH Meter Working Properly	OK
No Parts Missing (if missing, note in snags below)	OK		


SNAGS FOUND (0)

No snags logged for this visit.


DEFICIENCIES & SAFETY REMARKS

DG MAJOR DEFICIENCIES	—
SAFETY REMARKS	—
GENERAL REMARKS	—

SITE PHOTOS



Site / Nameplate

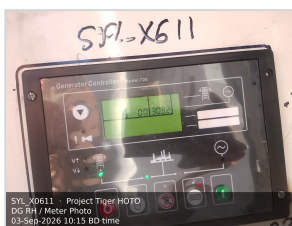

DG RH / Meter



Fuel Gauge

Md. Eidris Ali

Handed Over By · Dhaly Infratech Ltd
01750537433

Date: _____

Md. Ismail Hossain

Taken Over By · Alliance Computers
Limited
01847426858

Date: _____

BL Concern · Name / Signature

Date: _____

APPENDIX — PHOTO EVIDENCE (3)

Full-size reference photos for SYL_X0611, grouped by type and numbered for cross-reference against the tables above.

REQUIRED SITE PHOTOS (3)



Photo 1 — Site / Nameplate



Photo 2 — DG RH / Meter



Photo 3 — Fuel Gauge