

Site HOTO Report — SYL_X0073

Project Tiger · Dhaly Infratech → Alliance Computers Limited · Generated 09-Sep-2026 04:45 BD time

73%

FORM COMPLETION

13/15

CHECKLIST OK

0

OPEN SNAGS

0

TOTAL SNAGS

3

PHOTOS ATTACHED

Incomplete: the following expected fields were left blank in this submission — Site Type, BTS Type, Site Sharing.

SITE & HANDOVER DETAILS

SITE CODE	SYL_X0073	ZONE	Sylhet
HOTO DATE	2026-08-30	DISTRICT	Sylhet
HANDOVER ORG	Dhali Infratech Ltd	TAKEOVER ORG	Alliance Computers Limited
HANDOVER PERSON	Md.Bulbul Ahomed	TAKEOVER PERSON	Md. Ismail Hossain
HANDOVER PHONE	01406394565	TAKEOVER PHONE	01847426858
INSPECTED BY	Ismail Siraji	SECURITY GUARD	Yes
ACCESS KEY HANDED OVER	Yes	SITE TYPE	Not Filled
BTS TYPE	Not Filled		
SHARED WITH OPERATOR	Not Filled	SHARED OPERATOR NAME	—

GENERATOR INFORMATION

DG BRAND	Fg wilson	GENSET ASSET NO.	000
CAPACITY (KVA)	22	TYPE	Can
FUEL TANK CAPACITY	2000	PRESENT RH	42.2
FUEL (NO WATER)	14 L	FUEL (TOTAL)	14 L
WATER AMOUNT	00 L	FUEL AMOUNT (WORD)	Fourtin
DG SITE TYPE	Standard	DG LOCKED AFTER FUELING	—
DG PRESENT STATUS	NOK	GENSET ON ALARM	OK
BATTERY BRAND	Hamko 100Ah	BATTERY SERIAL	P8199420039
BATTERY AH	100	ENGINE SERIAL	35212u9527765
ATS BRAND	Local	ATS MODE	Auto
RH METER TYPE	Digital from controller	LAST SERVICE DATE	—
KEY TYPE	—	KEY STATUS — BTS	Local
KEY STATUS — DG ROOM	Local		

ACTIVE DG	1	CONNECTED FUEL TANKS	00
FAULTY/DISCONNECTED DG	00	FAULTY/DISCONNECTED TANKS	1

CONNECTED GENERATOR CHECKLIST & READINGS

ITEM	VALUE	ITEM	VALUE
Controller Status	OK	Black Smoke Status	OK
DG Battery Charger	OK	ATS Physical & Functional Status	OK
DG Automation (VDTC/RVDTC/Rectifier) per BL Standard	OK	Fuel Preserved at Safe & Appropriate Location	NOK
Exhaust Fan / Ventilation Sufficient When Running	OK	Sufficient Water in Radiator & Battery	OK
DG Radiator Condition	OK	DG Battery Condition	NOK
DG Runs in Both Auto & Manual Mode	OK	GENSET ON Alarm Functioning Properly	OK
Lub Oil Status (Level & Colour)	OK	DG RH Meter Working Properly	OK
No Parts Missing (if missing, note in snags below)	OK		

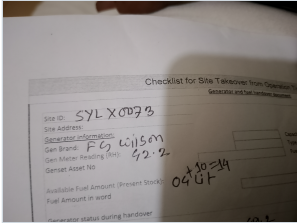
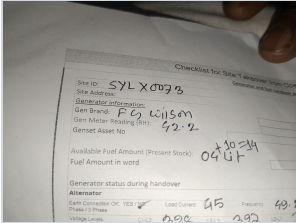
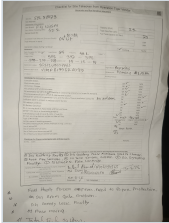
SNAGS FOUND (0)

No snags logged for this visit.

DEFICIENCIES & SAFETY REMARKS

DG MAJOR DEFICIENCIES	1.DG Battery faulty. 2.DG Battery cable aluminium need to change. 3.Hose pipe leakage. 4.Hi temperature sensor broken. 5.DG Dynamo faulty. 6.Silencer pipe leakage. 7.DG Room gate broken. 8.DG canopy lock faulty 9.1 Phase missing 10.Fuel thief aria need to proper protection. 11.1 pcs Transformer Faulty. 12.Last servicing date not found.
SAFETY REMARKS	—
GENERAL REMARKS	—

SITE PHOTOS

		
Site / Nameplate	DG RH / Meter	Fuel Gauge

Md.Bulbul Ahomed
Handed Over By · Dhali Infratech Ltd
01406394565
Date: _____

Md. Ismail Hossain
Taken Over By · Alliance Computers
Limited
01847426858
Date: _____

BL Concern · Name / Signature
Date: _____

APPENDIX — PHOTO EVIDENCE (3)

Full-size reference photos for SYL_X0073, grouped by type and numbered for cross-reference against the tables above.

REQUIRED SITE PHOTOS (3)

Checklist for Site Takeover from Operations Team

Generator and fuel handover documents

Site ID: SYL X0073

Site Address:

Generator information:

Gen Brand: FG Wilson

Gen Meter Reading (RH): 42.2

genset Asset No

Available Fuel Amount (Present Stock): 0467 + 10 = 14

Fuel Amount in word

Generator status during handover

Photo 1 — Site / Nameplate

Checklist for Site Takeover from OP
Generator and fuel handler

Site ID: SYLX0073

Site Address: _____

Generator information:

Gen Brand: FG Wilson

Gen Meter Reading (RH): 42.2

genset Asset No _____

Available Fuel Amount (Present Stock): 0461 ^{+ 10 = 14}

Fuel Amount in word _____

Generator status during handover

Alternator

Earth Connection OK: YES / NO	Load Current	Frequency
☒	<u>45</u>	<u>49.</u>
Phase / 3 Phase	<u>0.00</u>	<u>0.00</u>
Voltage 1 equals	<u>0.00</u>	<u>0.00</u>

Photo 2 — DG RH / Meter

[illegible]

Photo 3 — Fuel Gauge