

Site HOTO Report — SYL_X0073

Project Tiger · Dhaly Infratech → Alliance Computers Limited · Generated 26-Oct-2026 23:45 BD time

73%

FORM COMPLETION

13/15

CHECKLIST OK

9

OPEN SNAGS

9

TOTAL SNAGS

30

PHOTOS ATTACHED

Incomplete: the following expected fields were left blank in this submission — Site Type, BTS Type, Site Sharing.

SITE & HANDOVER DETAILS

SITE CODE	SYL_X0073	ZONE	Sylhet
HOTO DATE	2026-08-30	DISTRICT	Sylhet
HANDOVER ORG	Dhali Infratech Ltd	TAKEOVER ORG	Alliance Computers Limited
HANDOVER PERSON	Md.Bulbul Ahomed	TAKEOVER PERSON	Md. Ismail Hossain
HANDOVER PHONE	01406394565	TAKEOVER PHONE	01847426858
INSPECTED BY	Ismail Siraji	SECURITY GUARD	Yes
ACCESS KEY HANDED OVER	Yes	SITE TYPE	Not Filled
BTS TYPE	Not Filled		
SHARED WITH OPERATOR	Not Filled	SHARED OPERATOR NAME	—

GENERATOR INFORMATION

DG BRAND	Fg wilson	GENSET ASSET NO.	000
CAPACITY (KVA)	22	TYPE	Can
FUEL TANK CAPACITY	2000	PRESENT RH	42.2
FUEL (NO WATER)	14 L	FUEL (TOTAL)	14 L
WATER AMOUNT	00 L	FUEL AMOUNT (WORD)	Fourtin
DG SITE TYPE	Standard	DG LOCKED AFTER FUELING	—
DG PRESENT STATUS	NOK	GENSET ON ALARM	OK
BATTERY BRAND	Hamko 100Ah	BATTERY SERIAL	P8199420039
BATTERY AH	100	ENGINE SERIAL	35212u9527765
ATS BRAND	Local	ATS MODE	Auto
RH METER TYPE	Digital from controller	LAST SERVICE DATE	—
KEY TYPE	—	KEY STATUS — BTS	Local
KEY STATUS — DG ROOM	Local		

ACTIVE DG	1	CONNECTED FUEL TANKS	00
FAULTY/DISCONNECTED DG	00	FAULTY/DISCONNECTED TANKS	1

CONNECTED GENERATOR CHECKLIST & READINGS

ITEM	VALUE	ITEM	VALUE
Controller Status	OK	Black Smoke Status	OK
DG Battery Charger	OK	ATS Physical & Functional Status	OK
DG Automation (VDTC/RVDTC/Rectifier) per BL Standard	OK	Fuel Preserved at Safe & Appropriate Location	NOK
Exhaust Fan / Ventilation Sufficient When Running	OK	Sufficient Water in Radiator & Battery	OK
DG Radiator Condition	OK	DG Battery Condition	NOK
DG Runs in Both Auto & Manual Mode	OK	GENSET ON Alarm Functioning Properly	OK
Lub Oil Status (Level & Colour)	OK	DG RH Meter Working Properly	OK
No Parts Missing (if missing, note in snags below)	OK		

SNAGS FOUND (9)





SNAG #	SYSTEM	CATEGORY	COMPONENT	STATUS	OBSERVATIONS	ACTION	PHOTO
S-142	General	—	DG Battery	Faulty	DG battery faulty (from paper HOTO checklist PDF, transcribed 2026-09-16)	Open	—
S-143	General	—	DG Battery Cable	Faulty	Aluminium cable needs to be changed (from paper HOTO checklist PDF, transcribed 2026-09-16)	Open	—
S-144	General	—	Hose pipe	Faulty	Leakage (from paper HOTO checklist PDF, transcribed 2026-09-16)	Open	—
S-145	General	—	Hi-temp sensor	Faulty	Broken (from paper HOTO checklist PDF, transcribed 2026-09-16)	Open	—
S-146	General	—	DG Dynamo	Faulty	Faulty (from paper HOTO checklist PDF, transcribed 2026-09-16)	Open	—
S-147	General	—	Silencer pipe	Faulty	Leakage (from paper HOTO checklist PDF, transcribed 2026-09-16)	Open	—
S-148	General	—	DG room gate	Faulty	Broken (from paper HOTO checklist PDF, transcribed 2026-09-16)	Open	—
S-149	General	—	DG canopy lock	Faulty	Faulty (from paper HOTO checklist PDF, transcribed 2026-09-16)	Open	—
S-150	General	—	Electrical phase	Not Available	1 phase missing (from paper HOTO checklist PDF, transcribed 2026-09-16)	Open	—

DEFICIENCIES & SAFETY REMARKS

DG MAJOR DEFICIENCIES	1.DG Battery faulty. 2.DG Battery cable aluminium need to change. 3.Hose pipe leakage. 4.Hi temperature sensor broken. 5.DG Dynamo faulty. 6.Silencer pipe leakage. 7.DG Room gate broken. 8.DG canopy lock faulty 9.1 Phase missing 10.Fuel thief aria need to proper protection. 11.1 pcs Transformer Faulty. 12.Last servicing date not found.
-----------------------	---

SAFETY REMARKS	—
GENERAL REMARKS	PDF checklist notes: Multiple checklist NOKs: preservation of fuel at safe location (NOK - fuel theft-prone area, needs proper protection noted separately), sufficient water in radiator/battery (NOK), DG battery condition (NOK), lub oil status marked OK though. 'Exhaust fan' row annotated 'DG outdoor' (likely explaining no fan needed, not a fault). DG last servicing date: 'not found' (no date on filter). Neither Completed nor Not Completed box in Handover Status row appears checked - left null; given multiple significant faults this warrants human follow-up. Date of Handover field in the table itself was blank but a date '30-8-26' appears handwritten near the signature block, used as hoto_date.

SITE PHOTOS

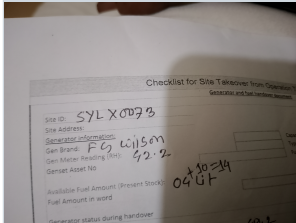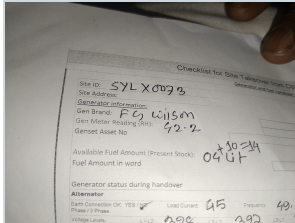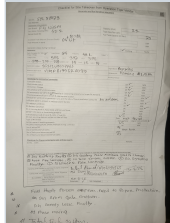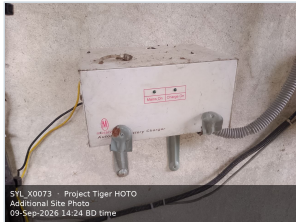 Handwritten checklist for Site Takeover from Operations. Site ID: SYL X0073, Site Address: F6 Wilson, Gen Brand: 92.2, Gen Model: 048034, Gen Asset No: 048034. Fuel Amount in word: 048034.	 Handwritten checklist for Site Takeover from Operations. Site ID: SYL X0073, Site Address: F6 Wilson, Gen Brand: 92.2, Gen Model: 048034, Gen Asset No: 048034. Fuel Amount in word: 048034.	 Fuel Gauge		
Site / Nameplate	DG RH / Meter	Fuel Gauge		
 Additional	 Additional	 Additional	 Additional	 Additional

Md.Bulbul Ahomed Handed Over By · Dhali Infratech Ltd 01406394565 Date: _____	Md. Ismail Hossain Taken Over By · Alliance Computers Limited 01847426858 Date: _____	BL Concern · Name / Signature Date: _____
---	--	--

APPENDIX — PHOTO EVIDENCE (30)

Full-size reference photos for SYL_X0073, grouped by type and numbered for cross-reference against the tables above.

REQUIRED SITE PHOTOS (3)

Photo 1 — Site / Nameplate

Photo 2 — DG RH / Meter

Photo 3 — Fuel Gauge

ADDITIONAL PHOTOS (27)



Photo 4 — Additional Photos 1



Photo 5 — Additional Photos 2



Photo 6 — Additional Photos 3

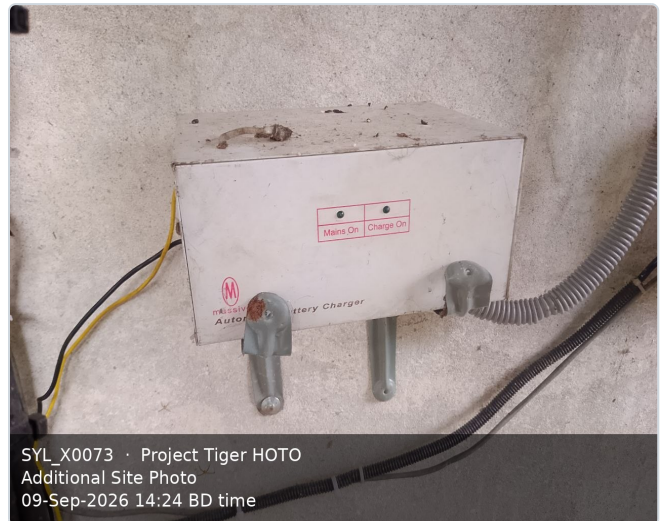


Photo 7 — Additional Photos 4



Photo 8 — Additional Photos 5

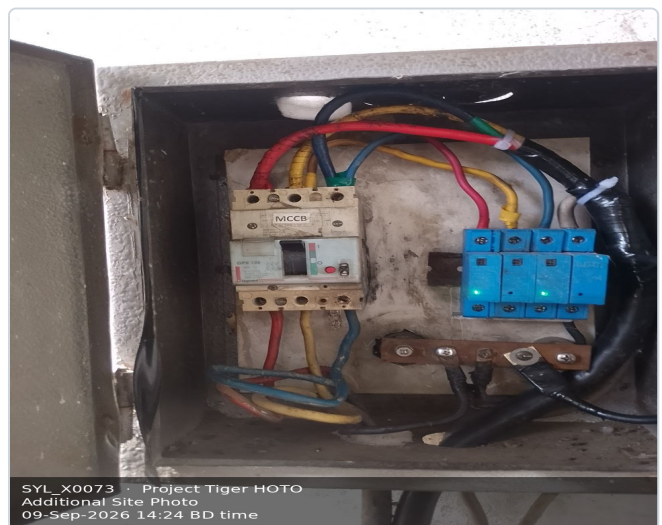


Photo 9 — Additional Photos 6

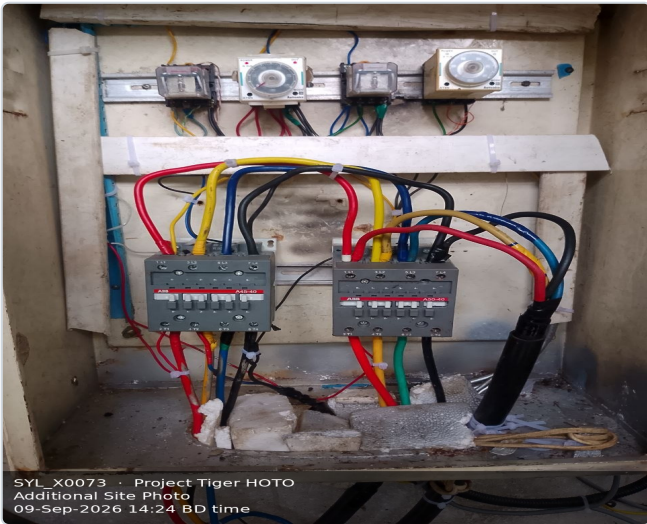


Photo 10 — Additional Photos 7



Photo 11 — Additional Photos 8



Photo 12 — Additional Photos 9



Photo 13 — Additional Photos 10



Photo 14 — Additional Photos 11



Photo 15 — Additional Photos 12



Photo 16 — Additional Photos 13

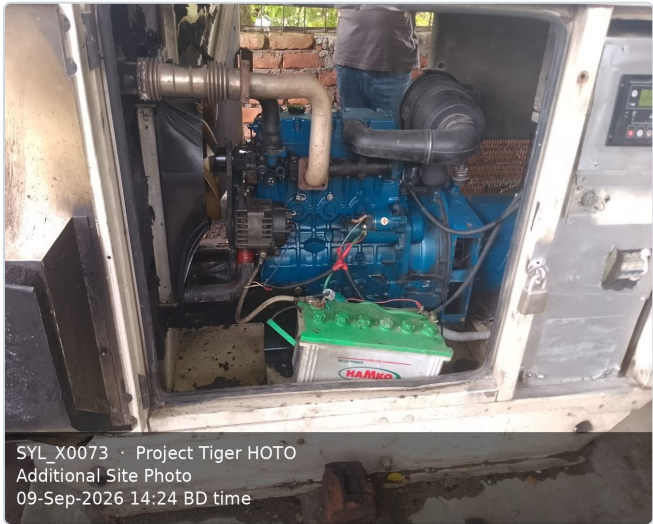


Photo 17 — Additional Photos 14



Photo 18 — Additional Photos 15



Photo 19 — Additional Photos 16

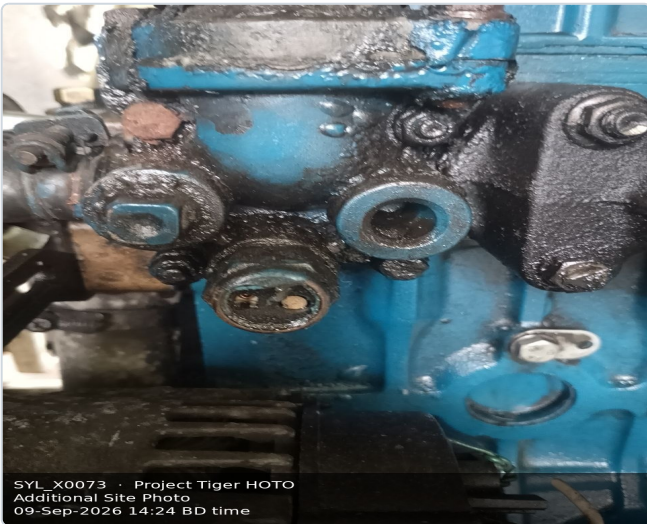


Photo 20 — Additional Photos 17



Photo 21 — Additional Photos 18



Photo 22 — Additional Photos 19



Photo 23 — Additional Photos 20



Photo 24 — Additional Photos 21



Photo 25 — Additional Photos 22



Photo 26 — Additional Photos 23

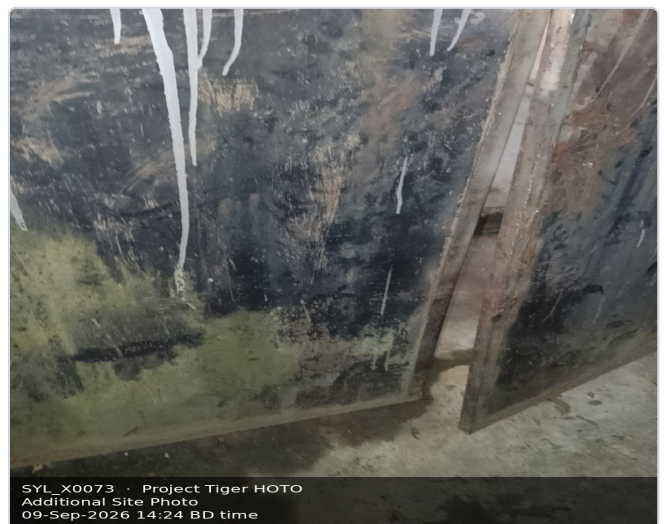


Photo 27 — Additional Photos 24



Photo 28 — Additional Photos 25

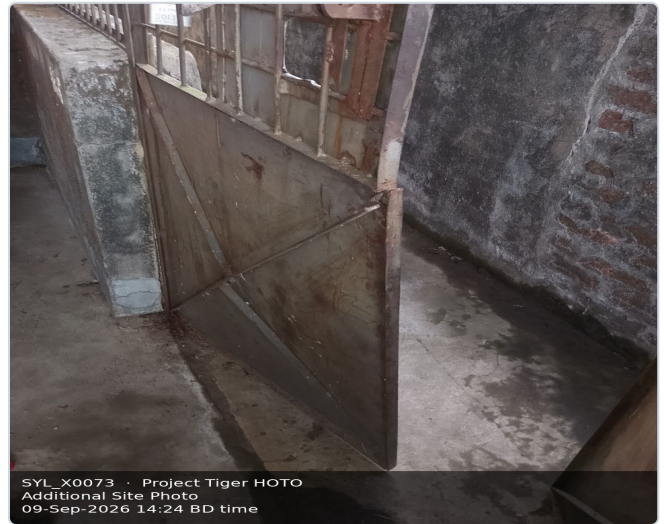


Photo 29 — Additional Photos 26



Photo 30 — Additional Photos 27