

Site HOTO Report — SYL_X0156

Project Tiger · Dhaly Infratech → Alliance Computers Limited · Generated 09-Sep-2026 00:10 BD time

100%

FORM COMPLETION

14/15

CHECKLIST OK

3

OPEN SNAGS

3

TOTAL SNAGS

6

PHOTOS ATTACHED

SITE & HANDOVER DETAILS

SITE CODE	SYL_X0156	ZONE	Sylhet
HOTO DATE	2026-09-02	DISTRICT	Sunamganj
HANDOVER ORG	Dhaly Infratech Ltd.	TAKEOVER ORG	Alliance Computers Limited.
HANDOVER PERSON	MD. Eidris Ali.	TAKEOVER PERSON	MD. Ismail Hossain.
HANDOVER PHONE	01750537433	TAKEOVER PHONE	01847426858
INSPECTED BY	Ismail Siraji	SECURITY GUARD	Yes
ACCESS KEY HANDED OVER	Yes	SITE TYPE	GFT
BTS TYPE	Outdoor		
SHARED WITH OPERATOR	No	SHARED OPERATOR NAME	N/A

GENERATOR INFORMATION


DG BRAND	Tempest	GENSET ASSET NO.	10030010KUE
CAPACITY (KVA)	20	TYPE	Can
FUEL TANK CAPACITY	800	PRESENT RH	2869.14
FUEL (NO WATER)	245 L	FUEL (TOTAL)	245 L
WATER AMOUNT	— L	FUEL AMOUNT (WORD)	Two Hundred Forty Five Liters
DG SITE TYPE	Standard	DG LOCKED AFTER FUELING	Yes
DG PRESENT STATUS	OK	GENSET ON ALARM	OK
BATTERY BRAND	Hamko	BATTERY SERIAL	P033WIDE0634
BATTERY AH	100	ENGINE SERIAL	JV51790U983071B
ATS BRAND	LOCAL	ATS MODE	Auto
RH METER TYPE	Digital from controller	LAST SERVICE DATE	2026-04-26
KEY TYPE	Local Key	KEY STATUS — BTS	Local
KEY STATUS — DG ROOM	Local		
ACTIVE DG	1	CONNECTED FUEL TANKS	1

FAULTY/DISCONNECTED DG	—	FAULTY/DISCONNECTED TANKS	—
------------------------	---	---------------------------	---

CONNECTED GENERATOR CHECKLIST & READINGS

ITEM	VALUE	ITEM	VALUE
Earth Connection OK	Yes	Load Current (A)	45
Frequency (Hz)	52.2	Phase	3 Phase
Output	376	Engine Brand	pERKINGS
Voltage L1-L2	376	Voltage L2-L3	376
Voltage L3-L1	378	Voltage L1-N	217
Voltage L2-N	217	Voltage L3-N	217
Current Line 1	15	Current Line 2	15
Current Line 3	15	N-G	1.35
Controller Status	OK	Black Smoke Status	OK
DG Battery Charger	OK	ATS Physical & Functional Status	OK
DG Automation (VDTC/RVDTC/Rectifier) per BL Standard	OK	Fuel Preserved at Safe & Appropriate Location	OK
Exhaust Fan / Ventilation Sufficient When Running	OK	Sufficient Water in Radiator & Battery	OK
DG Radiator Condition	NOK	DG Battery Condition	OK
DG Runs in Both Auto & Manual Mode	OK	GENSET ON Alarm Functioning Properly	OK
Lub Oil Status (Level & Colour)	OK	DG RH Meter Working Properly	OK
No Parts Missing (if missing, note in snags below)	OK		

SNAGS FOUND (3)

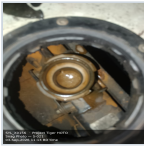SNAG #	SYSTEM	CATEGORY	COMPONENT	STATUS	OBSERVATIONS	ACTION	PHOTO
S-020	DG	DG - Other	Dg controller display not clean, Nothing on the display is visible	Faulty	—	Open	
S-021	DG	DG - Other	Radiator full block dust	Faulty	—	Open	
S-022	DG	DG - Other	DG fan belt loose.	Faulty	—	Open	

DEFICIENCIES & SAFETY REMARKS


DG MAJOR DEFICIENCIES	—
SAFETY REMARKS	—

GENERAL REMARKS

—

SITE PHOTOS

Site / Nameplate

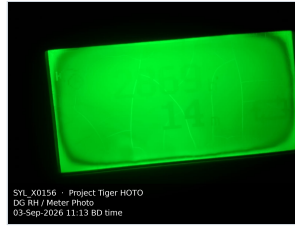

DG RH / Meter



Fuel Gauge

MD. Eidris Ali.

Handed Over By · Dhaly Infratech Ltd.
01750537433

Date: _____

MD. Ismail Hossain.

Taken Over By · Alliance Computers
Limited.

01847426858

Date: _____

BL Concern · Name / Signature

Date: _____

APPENDIX — PHOTO EVIDENCE (6)

Full-size reference photos for SYL_X0156, grouped by type and numbered for cross-reference against the tables above.

REQUIRED SITE PHOTOS (3)



Photo 1 — Site / Nameplate

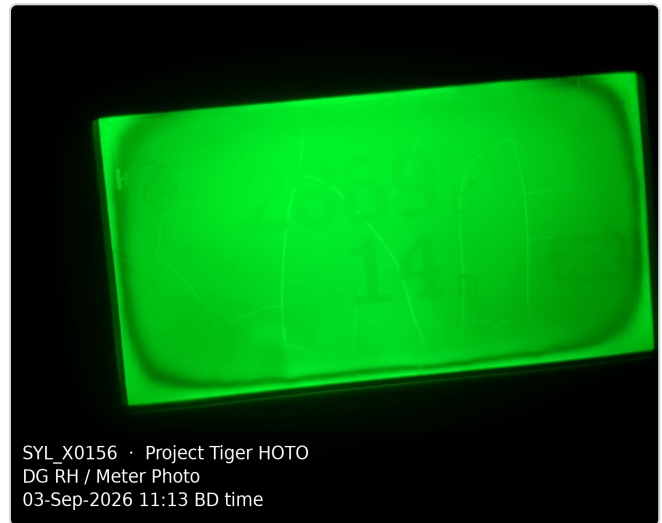


Photo 2 — DG RH / Meter



Photo 3 — Fuel Gauge

SNAG EVIDENCE PHOTOS (3)



**Photo 4 — S-020 — Dg controller display not clean,
Nothing on the display is visible**



Photo 5 — S-021 — Radiator full block dust

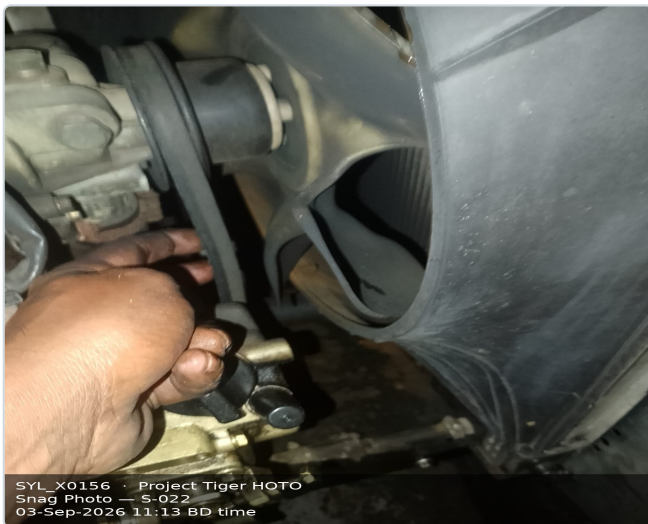


Photo 6 — S-022 — DG fan belt loose.