

Site HOTO Report — SYL_X0162

Project Tiger · Dhaly Infratech → Alliance Computers Limited · Generated 09-Sep-2026 04:45 BD time

73%

FORM COMPLETION

15/15

CHECKLIST OK

0

OPEN SNAGS

0

TOTAL SNAGS

3

PHOTOS ATTACHED

Incomplete: the following expected fields were left blank in this submission — Site Type, BTS Type, Site Sharing.

SITE & HANDOVER DETAILS

SITE CODE	SYL_X0162	ZONE	Sylhet
HOTO DATE	2026-08-30	DISTRICT	Sylhet
HANDOVER ORG	Dhali Infratech Ltd	TAKEOVER ORG	Alliance Computers Limited
HANDOVER PERSON	Md. Bulbul Ahomed	TAKEOVER PERSON	Md. Ismail hossain
HANDOVER PHONE	01406394565	TAKEOVER PHONE	01847426858
INSPECTED BY	Ismail Siraji	SECURITY GUARD	Yes
ACCESS KEY HANDED OVER	Yes	SITE TYPE	Not Filled
BTS TYPE	Not Filled		
SHARED WITH OPERATOR	Not Filled	SHARED OPERATOR NAME	—

GENERATOR INFORMATION

DG BRAND	Eg wilson	GENSET ASSET NO.	20060052IRA
CAPACITY (KVA)	22	TYPE	Can
FUEL TANK CAPACITY	2000	PRESENT RH	105.7
FUEL (NO WATER)	223 L	FUEL (TOTAL)	223 L
WATER AMOUNT	00 L	FUEL AMOUNT (WORD)	Two Hundred Twenty Three Liters
DG SITE TYPE	Standard	DG LOCKED AFTER FUELING	Yes
DG PRESENT STATUS	OK	GENSET ON ALARM	OK
BATTERY BRAND	Hamko	BATTERY SERIAL	P033wdcd0250
BATTERY AH	100	ENGINE SERIAL	Gv51792R
ATS BRAND	Local	ATS MODE	Auto
RH METER TYPE	Digital from controller	LAST SERVICE DATE	2026-08-22
KEY TYPE	—	KEY STATUS — BTS	Local
KEY STATUS — DG ROOM	Open space		

ACTIVE DG	1	CONNECTED FUEL TANKS	1
FAULTY/DISCONNECTED DG	00	FAULTY/DISCONNECTED TANKS	00

CONNECTED GENERATOR CHECKLIST & READINGS

ITEM	VALUE	ITEM	VALUE
Controller Status	OK	Black Smoke Status	OK
DG Battery Charger	OK	ATS Physical & Functional Status	OK
DG Automation (VDTC/RVDTC/Rectifier) per BL Standard	OK	Fuel Preserved at Safe & Appropriate Location	OK
Exhaust Fan / Ventilation Sufficient When Running	OK	Sufficient Water in Radiator & Battery	OK
DG Radiator Condition	OK	DG Battery Condition	OK
DG Runs in Both Auto & Manual Mode	OK	GENSET ON Alarm Functioning Properly	OK
Lub Oil Status (Level & Colour)	OK	DG RH Meter Working Properly	OK
No Parts Missing (if missing, note in snags below)	OK		

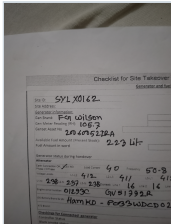
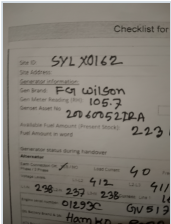
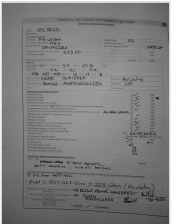
SNAGS FOUND (0)

No snags logged for this visit.

DEFICIENCIES & SAFETY REMARKS

DG MAJOR DEFICIENCIES	1) Dg fan belt not ok 2) Lube oil sensor & Temp sensor disconnected.
SAFETY REMARKS	—
GENERAL REMARKS	—

SITE PHOTOS

		
Site / Nameplate	DG RH / Meter	Fuel Gauge

Md. Bulbul Ahomed

Handed Over By · Dhali Infratech Ltd
01406394565
Date: _____

Md. Ismail hossain

Taken Over By · Alliance Computers Limited
01847426858
Date: _____

BL Concern · Name / Signature

Date: _____

APPENDIX — PHOTO EVIDENCE (3)

Full-size reference photos for SYL_X0162, grouped by type and numbered for cross-reference against the tables above.

REQUIRED SITE PHOTOS (3)

Checklist for Site Takeover
Generator and fuel

Site ID: SYL X0162

Site Address:

Generator information:

Gen Brand: FG Wilson

Gen Meter Reading (RH): 105.7

Genset Asset No 206052IRA

Available Fuel Amount (Present Stock): 223 Lit.

Fuel Amount in word

Generator status during handover

Alternator

Earth Connection OK	✓	S/N O	Load Current	40	Frequency	50.8
Phase / 3 Phase						
Voltage Levels:		L1-L2 412	L2-L3 411	L3-L1 411		
L1-N 238	L2-N 237	L3-N 238	Current: Line 1 16	Line 2 16	Line 3	

Engine serial number 01293C GV51992R

Site Battery Brand & Size Ham KD - P033WDCD02

ATS Brand:

Checkings for Connected generator

Controller Status

Black smoke

Photo 1 — Site / Nameplate

Checklist for

Site ID: **SYL X0162**

Site Address:

Generator Information:

Gen Brand: **FG Wilson**

Gen Meter Reading (RH): **105.7**

Genset Asset No **20060052TRA**

Available Fuel Amount (Present Stock): **223**

Fuel Amount in word

Generator status during handover

Alternator

Earth Connection OK ☒ YES / NO

Phase / 3 Phase

Voltage Levels

L1-L2 **412** L2-L3 **411**

L1-N **238** L2-N **237** L3-N **238** Current: Line 1 **615**

Engine serial number: **01293C**

Oil Battery Brand & Vol. **Ham**

Photo 2 — DG RH / Meter

[illegible]

Photo 3 — Fuel Gauge