

Site HOTO Report — SYL_G0397

Project Tiger · Dhaly Infratech → Alliance Computers Limited · Generated 09-Sep-2026 02:12 BD time

100%

FORM COMPLETION

13/15

CHECKLIST OK

5

OPEN SNAGS

5

TOTAL SNAGS

8

PHOTOS ATTACHED

SITE & HANDOVER DETAILS

SITE CODE	SYL_G0397	ZONE	Sylhet
HOTO DATE	2026-09-04	DISTRICT	Sunamganj
HANDOVER ORG	Dhaly Infratech Limited	TAKEOVER ORG	Alliance Computers Limited
HANDOVER PERSON	Md. Anwar	TAKEOVER PERSON	Md. Ismail Hossain
HANDOVER PHONE	01734713807	TAKEOVER PHONE	01847426858
INSPECTED BY	Ismail Siraji	SECURITY GUARD	Yes
ACCESS KEY HANDED OVER	Yes	SITE TYPE	GFT
BTS TYPE	Outdoor		
SHARED WITH OPERATOR	Yes	SHARED OPERATOR NAME	Grameen Phone

GENERATOR INFORMATION



DG BRAND	Mets	GENSET ASSET NO.	N/A
CAPACITY (KVA)	22	TYPE	Can
FUEL TANK CAPACITY	2000	PRESENT RH	1119
FUEL (NO WATER)	124 L	FUEL (TOTAL)	124 L
WATER AMOUNT	— L	FUEL AMOUNT (WORD)	One Hundred Twenty Four Liters
DG SITE TYPE	Remote	DG LOCKED AFTER FUELING	Yes
DG PRESENT STATUS	NOK	GENSET ON ALARM	OK
BATTERY BRAND	Hamko	BATTERY SERIAL	PW33WEDD0060
BATTERY AH	100	ENGINE SERIAL	GU51792R
ATS BRAND	Local	ATS MODE	Auto
RH METER TYPE	Digital from controller	LAST SERVICE DATE	2026-02-17
KEY TYPE	Local Key	KEY STATUS — BTS	Local
KEY STATUS — DG ROOM	Open		
ACTIVE DG	1	CONNECTED FUEL TANKS	1

FAULTY/DISCONNECTED DG	—	FAULTY/DISCONNECTED TANKS	—
------------------------	---	---------------------------	---

CONNECTED GENERATOR CHECKLIST & READINGS

ITEM	VALUE	ITEM	VALUE
Earth Connection OK	Yes	Load Current (A)	30
Frequency (Hz)	51.2	Phase	3 Phase
Output	390	Engine Brand	Perkins
Voltage L1-L2	390	Voltage L2-L3	389
Voltage L3-L1	390	Voltage L1-N	226
Voltage L2-N	225	Voltage L3-N	225
Current Line 1	15	Current Line 2	15
Current Line 3	0	N-G	2.31
Controller Status	OK	Black Smoke Status	NOK
DG Battery Charger	OK	ATS Physical & Functional Status	OK
DG Automation (VDTC/RVDTC/Rectifier) per BL Standard	OK	Fuel Preserved at Safe & Appropriate Location	OK
Exhaust Fan / Ventilation Sufficient When Running	OK	Sufficient Water in Radiator & Battery	OK
DG Radiator Condition	OK	DG Battery Condition	OK
DG Runs in Both Auto & Manual Mode	OK	GENSET ON Alarm Functioning Properly	OK
Lub Oil Status (Level & Colour)	NOK	DG RH Meter Working Properly	OK
No Parts Missing (if missing, note in snags below)	OK		

SNAGS FOUND (5)

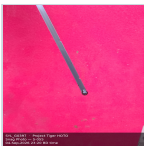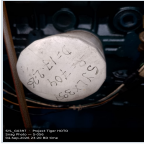
SNAG #	SYSTEM	CATEGORY	COMPONENT	STATUS	OBSERVATIONS	ACTION	PHOTO
S-055	DG	DG - Other	DG lube oil empty	Faulty	—	Open	
S-056	DG	DG - Other	servicing date run hour over	Faulty	—	Open	
S-057	DG	DG - Other	Font site canopy missing	Faulty	—	Open	
S-058	DG	DG - Other	DG back site canopy missing	Faulty	Charging dynamo faulty	Open	

S-059	DG	DG - Other	Need to overhaling	Faulty	—	Open	
-------	----	------------	--------------------	--------	---	------	---

DEFICIENCIES & SAFETY REMARKS

DG MAJOR DEFICIENCIES	—
SAFETY REMARKS	—
GENERAL REMARKS	—

SITE PHOTOS

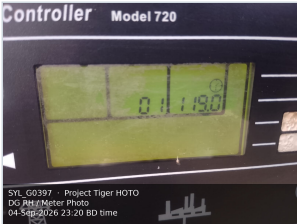 Site / Nameplate	 DG RH / Meter	 Fuel Gauge
---	--	---

Md. Anwar Handed Over By · Dhaly Infratech Limited 01734713807 Date: _____	Md. Ismail Hossain Taken Over By · Alliance Computers Limited 01847426858 Date: _____	BL Concern · Name / Signature Date: _____
--	--	--

APPENDIX — PHOTO EVIDENCE (8)

Full-size reference photos for SYL_G0397, grouped by type and numbered for cross-reference against the tables above.

REQUIRED SITE PHOTOS (3)



Photo 1 — Site / Nameplate



Photo 2 — DG RH / Meter



Photo 3 — Fuel Gauge

SNAG EVIDENCE PHOTOS (5)

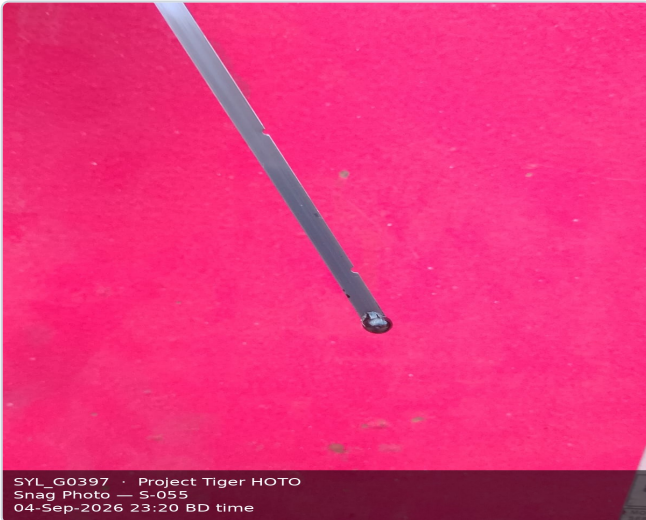


Photo 4 — S-055 — DG lube oil empty

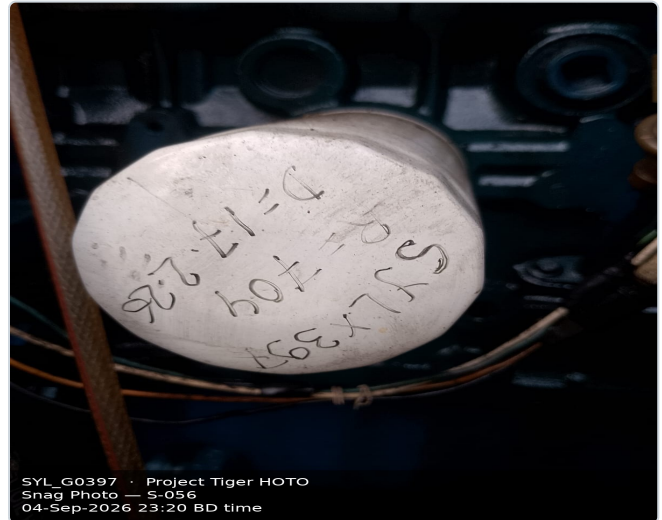


Photo 5 — S-056 — servicing date run hour over



Photo 6 — S-057 — Font site canopy missing



Photo 7 — S-058 — DG back site canopy missing

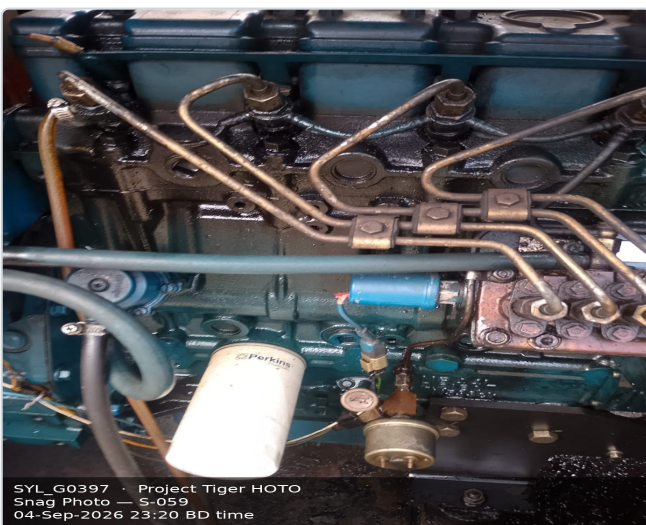


Photo 8 — S-059 — Need to overhaling