

Site HOTO Report — SYL_X0092

Project Tiger · Dhaly Infratech → Alliance Computers Limited · Generated 09-Sep-2026 04:45 BD time

73%

FORM COMPLETION

15/15

CHECKLIST OK

2

OPEN SNAGS

2

TOTAL SNAGS

3

PHOTOS ATTACHED

Incomplete: the following expected fields were left blank in this submission — Site Type, BTS Type, Site Sharing.

SITE & HANDOVER DETAILS

SITE CODE	SYL_X0092	ZONE	Sylhet
HOTO DATE	2026-09-07	DISTRICT	Moulavibazar
HANDOVER ORG	Dhaly Infratech	TAKEOVER ORG	Alliance Computers Limited
HANDOVER PERSON	Abu sayed	TAKEOVER PERSON	Sourav
HANDOVER PHONE	01716332171	TAKEOVER PHONE	01847426870
INSPECTED BY	sourov sarkar	SECURITY GUARD	Yes
ACCESS KEY HANDED OVER	—	SITE TYPE	Not Filled
BTS TYPE	Not Filled		
SHARED WITH OPERATOR	Not Filled	SHARED OPERATOR NAME	—

GENERATOR INFORMATION

DG BRAND	FG Wilson	GENSET ASSET NO.	—
CAPACITY (KVA)	30	TYPE	—
FUEL TANK CAPACITY	2000	PRESENT RH	90.3
FUEL (NO WATER)	315 L	FUEL (TOTAL)	315 L
WATER AMOUNT	— L	FUEL AMOUNT (WORD)	Three Hundred Fifteen Liters
DG SITE TYPE	—	DG LOCKED AFTER FUELING	Yes
DG PRESENT STATUS	OK	GENSET ON ALARM	OK
BATTERY BRAND	Volvo	BATTERY SERIAL	—
BATTERY AH	100	ENGINE SERIAL	—
ATS BRAND	Local	ATS MODE	Auto
RH METER TYPE	Digital from controller	LAST SERVICE DATE	—
KEY TYPE	Local Key	KEY STATUS — BTS	—
KEY STATUS — DG ROOM	—		

ACTIVE DG	1	CONNECTED FUEL TANKS	1
FAULTY/DISCONNECTED DG	—	FAULTY/DISCONNECTED TANKS	—

CONNECTED GENERATOR CHECKLIST & READINGS

ITEM	VALUE	ITEM	VALUE
Earth Connection OK	Yes	Load Current (A)	24
Phase	3 Phase	Voltage L1-L2	387
Voltage L2-L3	383	Voltage L3-L1	390
Voltage L1-N	210	Voltage L2-N	205
Voltage L3-N	210	Current Line 1	8
Current Line 2	8	Current Line 3	8
Engine Brand	Perkins	Controller Status	OK
Black Smoke Status	OK	DG Battery Charger	OK
ATS Physical & Functional Status	OK	DG Automation (VDTC/RVDTC/Rectifier) per BL Standard	OK
Fuel Preserved at Safe & Appropriate Location	OK	Exhaust Fan / Ventilation Sufficient When Running	OK
Sufficient Water in Radiator & Battery	OK	DG Radiator Condition	OK
DG Battery Condition	OK	DG Runs in Both Auto & Manual Mode	OK
GENSET ON Alarm Functioning Properly	OK	Lub Oil Status (Level & Colour)	OK
DG RH Meter Working Properly	OK	No Parts Missing (if missing, note in snags below)	OK

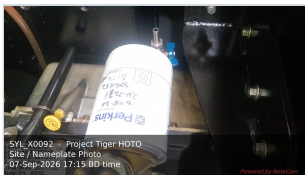
SNAGS FOUND (2)

SNAG #	SYSTEM	CATEGORY	COMPONENT	STATUS	OBSERVATIONS	ACTION	PHOTO
S-065	DG	DG - Other	Fuel Pipe (□□□□□ □□□)	Faulty	—	Open	—
S-066	DG	DG - Other	DG CB Problematic	Faulty	—	Open	—

DEFICIENCIES & SAFETY REMARKS

DG MAJOR DEFICIENCIES	—
SAFETY REMARKS	—
GENERAL REMARKS	—

SITE PHOTOS

 Site / Nameplate	 DG RH / Meter	 Fuel Gauge
---	--	---

Abu sayed

Handed Over By · Dhaly Infratech
01716332171

Date: _____

Sourav

Taken Over By · Alliance Computers
Limited
01847426870

Date: _____

BL Concern · Name / Signature

Date: _____

APPENDIX — PHOTO EVIDENCE (3)

Full-size reference photos for SYL_X0092, grouped by type and numbered for cross-reference against the tables above.

REQUIRED SITE PHOTOS (3)



Photo 1 — Site / Nameplate



Photo 2 — DG RH / Meter



Photo 3 — Fuel Gauge